



2GC0213520090601

WOOD DANS TRUCK EQUIPMENT 2GC02135 2009/06/01 TEBBE, PATRICIA PERRYSBURG



State of Ohio Environmental Protection Agency

Northwest District Office

347 North Dunbridge Rd.
Bowling Green, OH 43402-9398

TELE: (419) 352-8461 FAX: (419) 352-8468
www.epa.state.oh.us

Ted Strickland, Governor
Lee Fisher, Lieutenant Governor
Chris Korleski, Director

Re: Wood County
Dans Truck Equipment
Construction
Storm Water

June 1, 2009

Mr. Dan Schimmoeller
8042 Fremont Pike
Perrysburg, Ohio 43561

Dear Mr. Schimmoeller:

On January 7, 2009, I inspected the Dans Truck Equipment development which is located at 8042 Fremont Pike, Perrysburg Township, Wood County. The purpose of my visit was to evaluate compliance of the site with your National Pollutant Discharge Elimination System (NPDES) Permit for storm water associated with construction activity, Construction General Permit (CGP) Facility ID NO. 2GC02135*AG. The inspection was conducted under the provisions of Ohio's water pollution control statutes, Ohio Revised Code (ORC) Chapter 6111. The following comments are a result of the inspection:

1. At the time of the inspection, construction had mostly been completed with the building completed, a parking area installed, and a septic system installed. There was also a storm water pond on site. The ground was frozen and snow covered.
2. The site appeared to be at final grade but despite the snow it was obvious that not all of the site had been stabilized. The CGP permit requires that portions of the construction site which will be inactive for more than 21 days must have temporary stabilization initiated within the first seven days. Permanent stabilization is required within seven days on any portion of the site that has reached final grade or will be idle for longer than one year. If seasonal conditions prohibit the establishment of vegetative cover, other means, such as mulching and matting, must still be used and maintained until more permanent methods can be implemented.
3. Silt fence along the north side of the property was not maintained and was falling and sagging in numerous places.
4. There were stock piles of soil on site that were not stabilized.
5. The storm water pond showed erosion patterns that gave evidence that this control was not working properly. Straw bales were installed at both the inlet and the outlet of the pond.


Mr. Dan Schimmoeller
June 1, 2009
Page Two

Please be aware that before you may terminate coverage of the CGP, the entire site must have a minimum of 70% permanent vegetative coverage and permanent post-construction controls must be installed. Until the CGP is terminated, you must continue weekly inspections of the stormwater sediment and erosion controls as per the CGP. Inspections must also be made within 24 hours of a one-half inch rain event. Logs of those inspections must be maintained for at least three years after the CGP has been terminated.

Please send written notification of what corrective measures you have taken to address the above noted violations within 10 days of the date on this letter.

If you have any question I may be contacted at (419) 373-3016 or by e-mail at patricia.tebbe@epa.state.oh.us. Please note that a phone call will not substitute for written notification of permit violation corrections.

Sincerely,

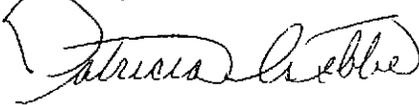

Patricia A. Tebbe, P.E.
Division of Surface Water

/lb

pc: ~~DSW: NWDO file~~
Follow-up file
Wood County Engineer
Wood County SWCD