 




John R. Kasich, Governor  
Mary Taylor, Lt. Governor  
Scott J. Nally, Director



**NOTICE OF VIOLATION – ACTION REQUIRED**

February 7, 2013

David Kraft  
4095 Lancaster Thornville Road  
Pleasantville, OH 43148

Fairfield County  
Castaway Restaurant  
TRANSIENT NON-COMMUNITY PWS  
PWS ID: OH2330712

Dear Public Water System Owner:

The Public Water System serving CASTAWAY RESTAURANT is in violation of the Ohio Administrative Code (OAC) for:

**Failure to respond in Writing within 30 days**

This letter is notification that the Castaway Restaurant has not complied with requirements issued during this Agency's last survey performed on November 28, 2013, in violation of rule 3745-81-60 of the Ohio Administrative Code. The PWS was notified in correspondence dated December 19, 2013 to respond in writing no later than 30 days, with time frames for:


1. Protection (i.e., boulders or posts) must be installed around the well (Well 0001) to prevent the well from being damaged by lawn care activities or other traffic. Please send a picture of the protection to this office once it is installed.
2. A yard hydrant is connected to the well. This is a potential source of contamination either from the standing water in the pipe of the hydrant or from back siphonage when a hose is connected to the hydrant. During the survey Ms. Ruff stated that the yard hydrant had not been used for a long time and it would be removed to fix the problem. Please send a picture of area around the well to this office once the hydrant is removed.
3. The well is not vented and not properly sealed. To fix these problems, please replace the existing well cap with a well cap that conforms to "Water System Council Pitless Adaptor Standard PAS-97(04)" (PAS-97 standards). Well vents that are integral with the well cap are acceptable as long as they are screened and face downward. Following is the link to a website with a listing of products meeting PAS-97 standards:  
[http://www.watersystemscouncil.org/standards\\_products.php?std=2](http://www.watersystemscouncil.org/standards_products.php?std=2)  
Please send a picture of the new well cap to this office once it is installed.

4. The well must be disinfected after the removal of the yard hydrant and the replacement of the well cap. After the well has been properly disinfected, a "special" total coliform bacteria sample must also be collected. A boil advisory must be in place until the lab reports that the bacteria sample is total coliform negative (safe). It is recommended that the removal of the yard hydrant and the replacement of the well cap be done at the same time. If that is the case, you only need to disinfect the well once and collect one "special" total coliform bacterial sample.
  
5. All public water systems are required by Ohio Administrative Code rule 3745-81-21 to prepare and maintain a written Sample Siting Plan for the collection of total coliform bacteria samples at sites which are representative of water throughout the distribution system. The plan identifies routine and repeat sampling locations to collect bacteriological samples according to a written Sample Siting Plan. During the survey we gave Ms. Ruff a copy of the Sample Siting Plan. Please complete it and send a copy of the first page of the plan to this office.

Please provide a schedule for compliance with each of the requirements within 10 days of the date of this letter.

If you have any questions please call your Ohio EPA representative at (614) 728-3871.

Sincerely,

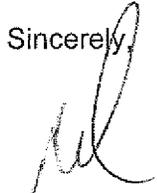

Mark Boden  
Environmental Specialist  
Division of Drinking and Ground Waters  
Central District Office

ec: CDO DDAGW AA (State Violation)