



Environmental
Protection Agency

John R. Kasich, Governor
Mary Taylor, Lt. Governor
Scott J. Nally, Director

July 9, 2012

John Miller
John Miller Poultry Farm
1700 Martinsburg Road
Utica, OH 43080

**Re: Storm Water Inspection at John Miller Poultry Farm
Permit Number: 4GC03730*AG**

Dear Mr. Miller:

This letter is written in follow-up to a construction storm water inspection by Alicia Rector and Abigail Tamkin of the Ohio EPA, at John Miller Poultry Farm located at 1700 Martinsburg Road in Utica, Ohio on June 28, 2012. The purpose of the inspection was to evaluate compliance with Ohio EPA's General Storm Water Permit Associated with Construction Activities. During the inspection, we noted the following:

Sediment and Erosion Controls

- It appears the majority of the site is draining to a centralized sediment basin with the exception of a few outlying areas. All outlying areas which are disturbed and not draining to the basin intended for treatment must be addressed with perimeter silt fence or an acceptable alternative as noted in Figure 1.
- During the inspection, it was noted that the temporary riser was not effectively sealed to the outlet structure. This results in the elimination of all effective sediment storage. Corrective measures must be taken to seal the riser to the outlet structure to ensure ponding. The riser must be set to an elevation to accommodate the required storage of 67 cubic yards per acre of drainage
- Be aware the General Permit states that all barren areas which remain idle in excess of 21 days must be protected from erosion within seven days of the last earth disturbing activities. In addition, erosion protection must be implemented for all areas of final grade within seven (7) days.

John Miller
John Miller Poultry Farm
Page -2-

- Inlet protections are required provided the storm sewer system is not routed to an approved centralized sediment basin or demonstrate an acceptable alternative.
- Containment measures must be implemented for all concrete washout conducted at this site (See Figure 2).

If you have any questions regarding this letter or the inspection, please do not hesitate to call me at our Central District Office at (614) 728-3844. In addition, please provide a written response to the action items addressed above within ten days from receipt of this letter. A follow-up inspection will be conducted to ensure the minimum conditions of the General Permit have been met.

Sincerely,



Harry Kallipolitis
Stormm Water Coordinator
Division of Surface Water
Central District Office

c: Jeff Bohne, Water Quality Supervisor, DSW/CDO



Figure 2: Void of silt fence, and does not appear to be draining to the centralized sediment basin



Figure 1: concrete washout lacking containment