

July 9, 2013

Steve Fuller
TH Midwest, Inc.
2600 Corporate Exchange Drive, Suite 170
Columbus, OH 43231

**Re: Construction Storm Water Inspection at Turkey Hill #717 / Franklin County
Permit Number: 4GC04026*AG**

Dear Mr. Fuller:

This letter is written regarding a storm water inspection conducted by Brittany Turner and Elizabeth Pleta of the Ohio EPA at Turkey Hill #717 located at 950 Georgesville Road, Columbus on June 19, 2013. The purpose of the inspection was to evaluate compliance with the General Storm Water Permit associated with Construction Activities. During the inspection, our staff noted the following issues associated with construction activities at this site:


Sediment and Erosion Control:

- The silt fence on the west side must be extended to address all barren areas to ensure compliance with the Ohio EPA's General Storm Water Permit (See Figure 1).
- The silt fence on the east portion of the site has failed and will require maintenance at this time (See Figure 2).
- Concrete washing activities were noted on site. A washout containment area must be established to ensure compliance with the Ohio EPA's General Storm Water Permit.
- The sediment pond on site appears to be over burdened with sediment. All sediment impoundments must be sized with a sediment storage volume of sixty-seven (67) cubic yards per acre of drainage for the dewatering zone and thirty seven (37) cubic yards per acre of disturbance for the sediment settling zone (See Figure 3). It was apparent the outlet structure was not completed to ensure dewatering between rain events. Please complete the impoundment and outlet structure to ensure compliance.

Steve Fuller
TH Midwest, Inc.
Page 2

If you have any questions regarding this letter or the inspection, please do not hesitate to contact me at our Central District Office at 614-728-3844 or email at harry.kallipolitis@epa.state.oh.us.

Sincerely,

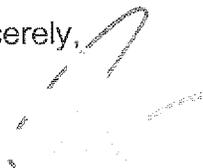

Harry Kallipolitis
Storm Water Coordinator
Division of Surface Water
Central District Office

c: Todd Williams, PETCO Construction, Inc.

HK/nsm Turkey Hill #717 6-19-13

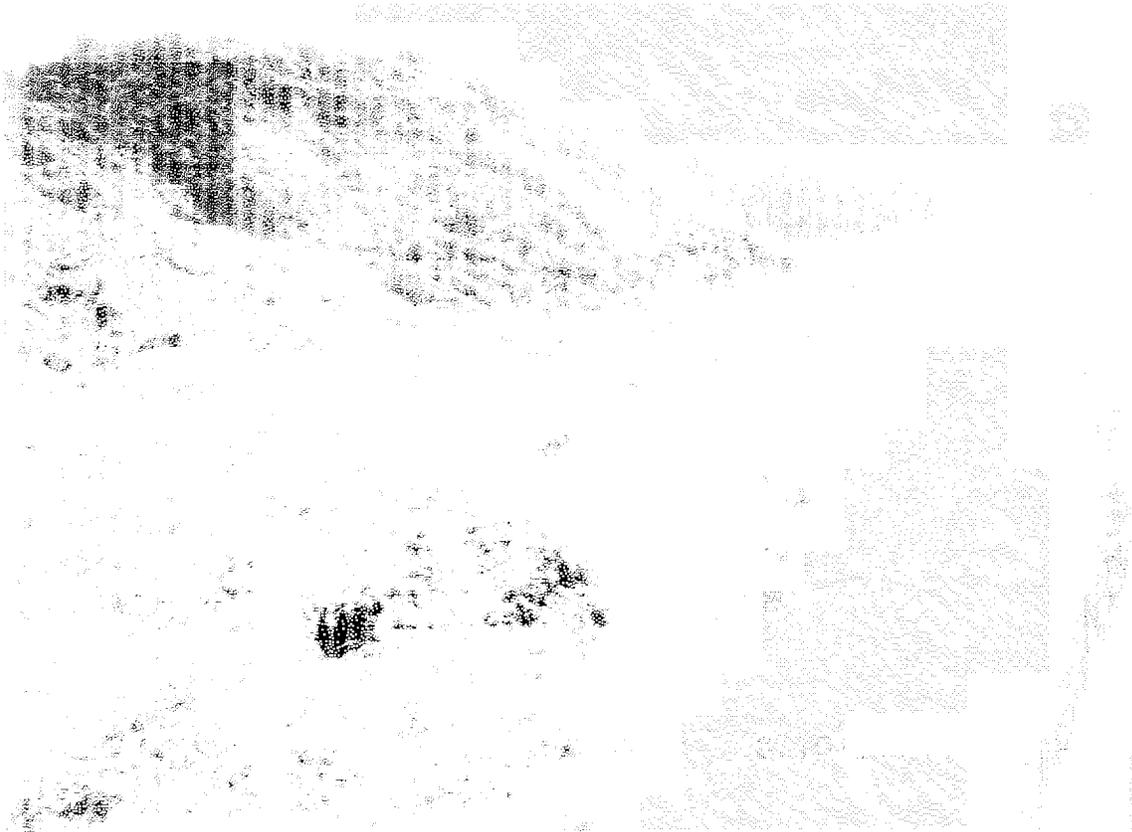


Figure 1: Silt fence extension required

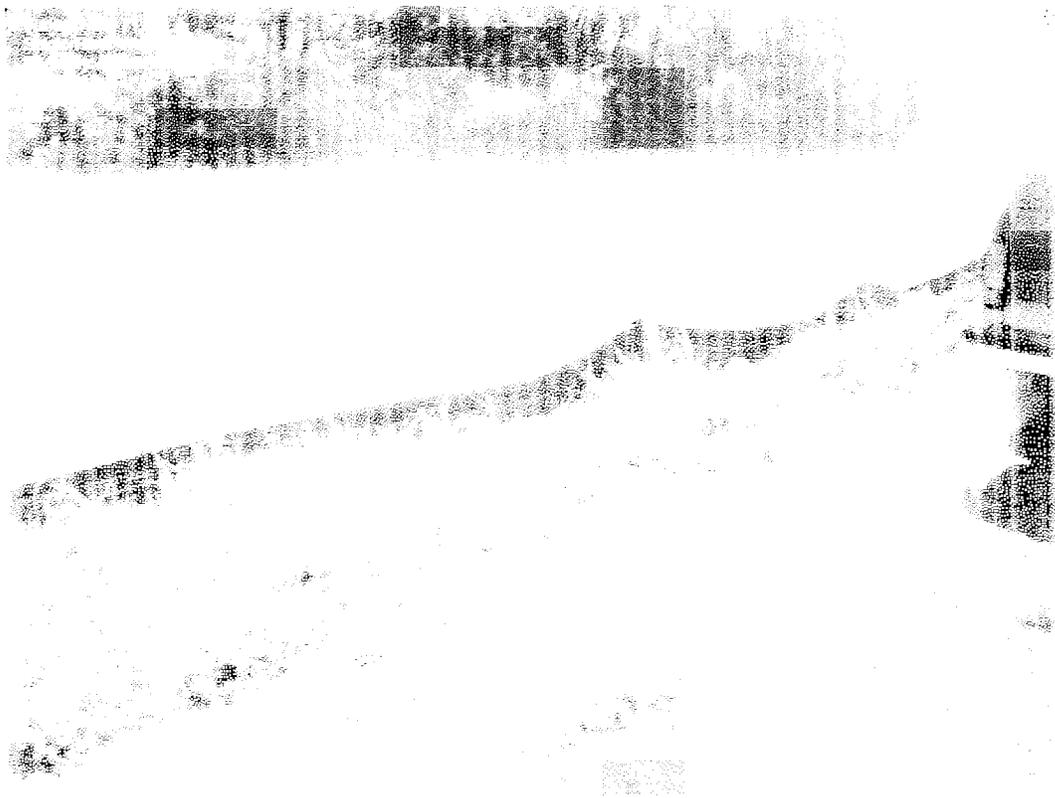


Figure 2: Silt fence requires maintenance

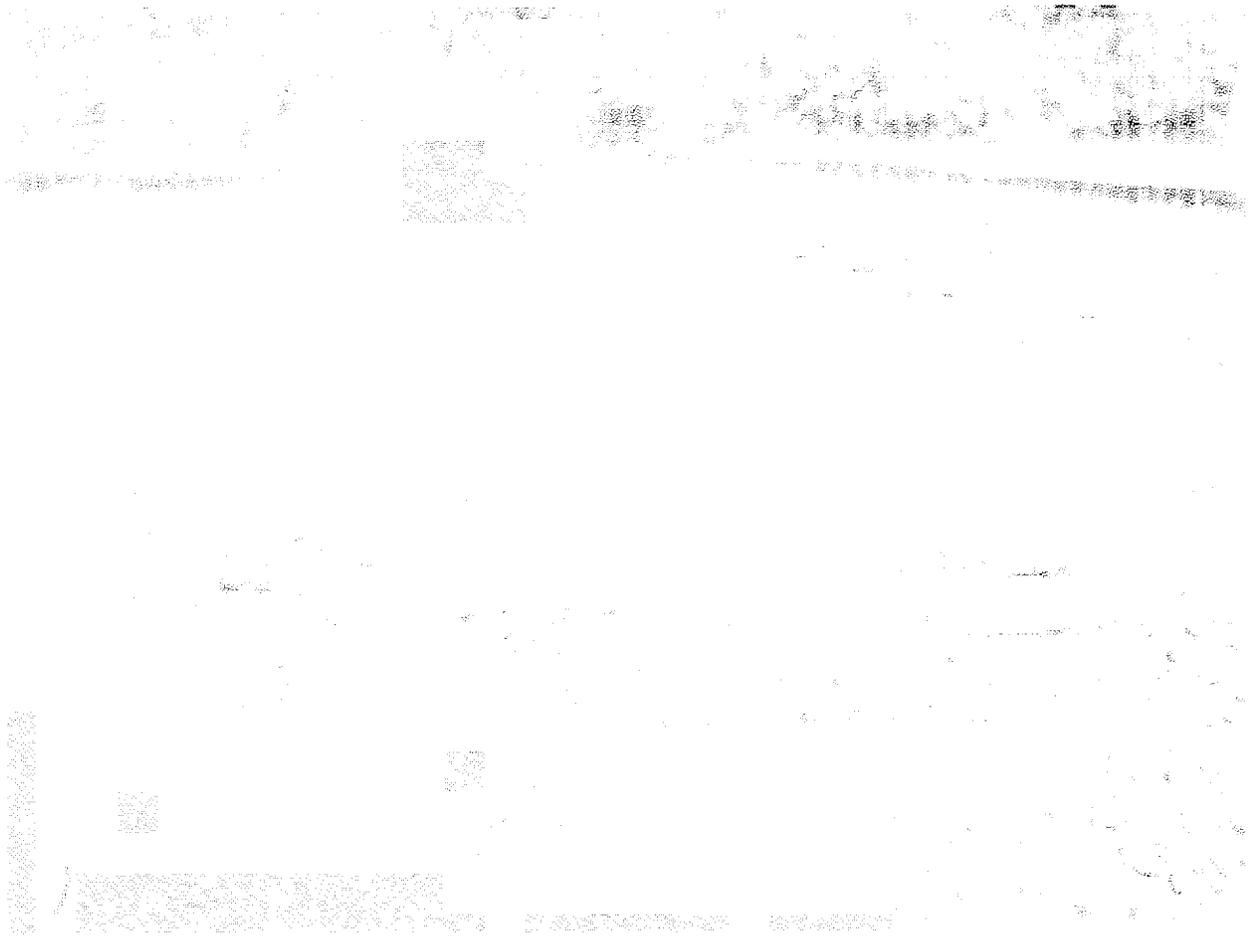


Figure 3: Pond over capacity