



Environmental  
Protection Agency

John R. Kasich, Governor  
Mary Taylor, Lt. Governor  
Scott J. Nally, Director

Re: Fulton County  
Storm Water Construction Activity  
Pettisville New PK-12 School  
Permit No. 2GC02456\*AG

June 29, 2011

Mr. Steve Switzer  
Pettisville Local Schools  
232 Summit Street  
Pettisville, Ohio 43553

Miller Brothers Construction, Inc.  
1613 South Defiance Street  
P. O. Box 30  
Archbold, Ohio 43502

The Dailey Company  
179 Northpointe Drive  
Lake Orion, Michigan 48359

Dear Mr. Switzer et al:

On June 6, 2011, I performed an inspection of the Pettisville PK-12 School, located at 232 Summit Street, in the Village of Pettisville, Fulton County. The purpose of this visit was to evaluate compliance of the site with the National Pollutant Discharge Elimination System (NPDES) permit for storm water discharges associated with construction activity, also known as the Construction General Permit (CGP). The inspection was conducted under the provisions of Ohio's water pollution control statutes, Ohio Revised Code (ORC) Chapter 6111.

As a result of the inspection I have the following comments:

1. At the time of inspection the site was active and the building had been erected.
2. The stormwater pollution prevention plan and inspection logs were not observed as there were no personnel at the construction office on Summit when I stopped there both before and after the inspection.
3. A chain link fence was erected around the site. Inlet protection had been installed on catch basins. However, there is so much erosion from off the property that the inlet protection was covered with dirt.
4. Dirt piles along the fence along County Road D were not stabilized and the silt fence along the dirt piles was overburdened in numerous places by dirt. *This is a violation of Part III.G.2.d of the CGP.*
5. Areas south of County Road D were not stabilized. *This is a violation of Part III.G.2.b.i of the CGP.*


Mr. Steve Switzer  
Miller Brothers Construction, Inc.  
The Dailey Company  
June 29, 2011  
Page Two

6. A significant amount of litter was around the site including the parking area on the south side of County Road D. *This is a violation of Part III.G.2.g of the CGP.*
7. Along the west side of the site, there was no protection along the stream. *This is a violation of Part III.G.2.d.v of the CGP.*
8. Silt fence had fallen in numerous places along the stream bank on the south side of County Road D. *This is a violation of Part III.G.2.g of the CGP.*
9. Construction entrances are not properly constructed and maintained allowing for tracking of sediment onto the road. *This is a violation of Part III.G.2.b.of the CGP.*
10. Concrete, or other materials, was being improperly washed out onto the ground on the east side of the building. *This is a violation of Part III.G.2.g of the CGP.*

I did not review the SWP3 or any inspection logs at the time of my inspection. Please submit **written** notification of what corrective measures you have taken to correct the above violations to my attention at this office within 10 days of the date of this letter. Please, also submit the SWP3 and the past three month's inspection logs to me with your response.

If you have any questions, you may contact me at (419) 373-3016 or by e-mail at [patricia.tebbe@epa.state.oh.us](mailto:patricia.tebbe@epa.state.oh.us).

Sincerely,

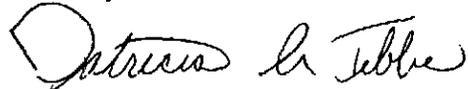

Patricia A. Tebbe, P.E.  
Division of Surface Water

/cs

pc: ~~DSW-NWDO-File~~  
Fulton County Soil & Water Conservation District  
Fulton County Engineer