



State of Ohio Environmental Protection Agency

Southeast District Office

2195 Front Street
Logan, Ohio 43138

TELE: (740) 385-8501 FAX: (740) 385-6490
www.epa.state.oh.us

Ted Strickland, Governor
Lee Fisher, Lieutenant Governor
Chris Korleski, Director

March 28, 2007

**Re: Monroe County
Woodsfield
CEI
Permit #0PB00051*FD
NPDES #OH0028177
Correspondence (PWW)**

Mr. Terry Comstock, Superintendent
Woodsfield Water and Wastewater
670 Old Brick Road
Woodsfield, Ohio 43793

**Subject: Comments for the Compliance Evaluation Inspection
Please Respond by April 20, 2007**

Dear Mr. Comstock:

I performed a CEI on March 19, 2007 at the Village of Woodsfield WWTP. I was accompanied by Tim Campbell, Ohio EPA; Aaron Pennington, Ohio EPA; Mike Jones, Chief Operator, Woodsfield; Larry Keylor, Operator, Woodsfield; Paul Robinson, Plant Operator, Woodsfield; Vernon Henthorn, President of City Council, Woodsfield; and you. The following are the comments from the inspection:

- **The laboratory has some deficiencies.**
- **The overall plant operation.**
- **We discussed the Long Term Control Plan.**

The laboratory has some deficiencies:

There was food stored in the refrigerator. On page 1-29 of the *Standard Methods for the Examination of Water and Wastewater, 19th Edition, 1995*, food storage is prohibited in the laboratory and is highly discouraged.

The Ohio EPA does not enforce OSHA law, however, *OSHA Standard 1910.450, APP A states, "(f) Performance. Rate: 4-12 room air changes/hour is normally adequate general ventilation if local exhaust systems such as hoods are used as the primary method of control (194)." This can be used as a reference to adequately size a range or fume hood for your laboratory. Please affix a label to your range hood stating the CFM of the air exchanger.*

There wasn't a Quality Assurance/Quality Control Manual. The lab does have procedures established for testing and sampling. Put the procedures in a manual and use this as your QA/QC Manual. This will help to insure continuity in the laboratory.

The overall plant operation:

During the tour of the plant, it was determined that the grit system was online. The comminutor was pulled out of the influent channel for maintenance. All influent and RAS pumps were operational. The plant has 2 clarifiers. One of the clarifiers had been down for maintenance but was repaired and presently in the standby operation mode; the clarifier should be returned to service ASAP. The tank walls and weirs were being cleaned weekly and the effluent had minimal solids content and appeared to be clear.


The chlorine feed room had buckets of unspecified chemicals stored in the room. Please remove these chemicals ASAP. **Also**, please remove your tank repair kit from the room.

We discussed the long term control plan:

The Ohio EPA is currently awaiting additional information for the *downtown* separation portion of the plan. It was discussed what the best and most cost effective approach would be. We also explained that the permit would be renewed along with approval of the plan. The permit would include a schedule of implementation. The village will be receiving a comment letter discussing uncompleted items included in the Long Term Control Plan.

Overall, I would rate the facility as satisfactory. Please continue your efforts on sludge handling and overall plant operations. Please respond to these comments by April 20, 2007.

Sincerely,

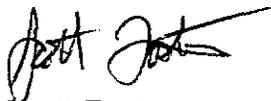

Scott Foster
Environmental Specialist 2
Division of Surface Water

SF/dh

Enclosure

c: Vernon Henthorn, President of Council, Woodsfield

**NPDES
Compliance Inspection Report**

A. NATIONAL DATA SYSTEM CODING

Permit No.	NPDES No.	Date	Inspection Type	Inspector	Facility Type
0PB00051*FD	OH0028177	March 19, 2007	C	S	1

B. FACILITY DATA

Name and Location of Facility Inspected	Entry Time	Permit Effective Date
Village of Woodsfield WWTP 670 Old Brick Road Woodsfield, Ohio 43793	11:00 AM	August 1, 2002
	Exit Time	Permit Expiration Date
	1:00 PM	July 31, 2007

Name(s) and Title(s) of On-Site Representative(s)	Phone Number(s)
Terry Comstock, Superintendent	740-472-1233
Name, Address and Title of Responsible Official	Phone Number
Terry Comstock, Superintendent	740-472-1233

C. AREAS EVALUATED DURING INSPECTION

<u>S</u> Permit	<u>S</u> Flow Measurement	<u>N</u> Pretreatment
<u>S</u> Records/Reports	<u>M</u> Laboratory	<u>N</u> Compliance Schedules
<u>S</u> Operations & Maintenance	<u>S</u> Effluent/Receiving Waters	<u>S</u> Self-Monitoring Program
<u>S</u> Facility Site Review	<u>S</u> Sludge Storage/Disposal	<u>N</u> Other
<u>N</u> Collection System		

(S = Satisfactory; M = Marginal; U = Unsatisfactory; N = Not Evaluated)

D. SUMMARY OF FINDINGS/COMMENTS (attach additional sheets if necessary)

See Attached Letter.



 Scott Foster, Inspector, Ohio EPA, Southeast District Office

3/28/07

 Date



 Timothy M. Campbell, Reviewer, Ohio EPA, Southeast District Office

3/28/07

 Date