



September 30, 2011

Scott Snedegar
Central Ohio Oil, Inc.
795 Marion Road
Columbus, OH 43207

**Re: Central Ohio Oil, Inc. / Franklin County
Notice of Violation
Industrial Storm Water Permit 4GR00225*CG**

Dear Mr. Snedegar:


This letter is written in regard to the storm water inspection that I conducted at Central Ohio Oil, Inc. located at 795 & 809 Marion Road in Columbus, Ohio. The inspection was conducted on September 20, 2011, as a result of a complaint stating that your secondary containment was being used as storage for process wastewater. I was escorted around your facility by Scott Owen. Please consider this a formal notice of violation. The following items were noted during the inspection, also please see attached pictures:

1. There was an overflow of an oil storage tank. The pretreatment system could not process the overflow. The overflow was directed to a secondary containment area. Process wastewater or other fluids should not be stored in the secondary containment area. The secondary containment area should be used for its intended purpose. Mr. Owen stated in the future that the process wastewater will be hauled off-site for treatment.
2. The loading area had excessive oil and grease on the gravel and pavement around the area. It is recommended to put this area under roof and create a larger containment area to allow trucks to unload in the area.
3. The loading/unloading hoses should be stored in a containment area for various processes. There were numerous stains on the gravel and pavement through-out your facility. There needs to be better housekeeping at the site in order to prevent and absorb spills. Spill kits should be located through-out the facility at loading/unloading areas and transfer stations.
4. There was a pallet of oily equipment parts stored outside. Oily parts should be stored in containment under roof.
5. There was a discharge from a dumpster that was located just inside the garage. Controls or best management practice should be used to prevent runoff from the dumpsters going to the outside pavement.

6. Collection drains for an unloading area were clogged and allowing flow to discharge outside of the containment area. Please clean and maintain collection drains.
7. Please submit an electronic copy of your spill prevention, control and countermeasure plan and storm water pollution prevention plan. The plans should be reviewed annually or after there is a change in management. The plans should also be updated to address the issues listed above.

If you have any questions regarding this letter or my inspection, please do not hesitate to contact me at our Central District Office at 614-728-3851.

Sincerely,

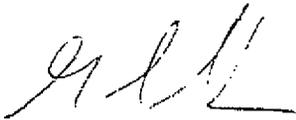


Gregory L. Sanders
Environmental Specialist
Division of Surface Water
Central District Office

Enclosures

c: Jeff Bohne, DSW/CDO
Brent Smith, City of Columbus, Pretreatment Group
ec: Greg Sanders, DSW/CDO

GS/nsm Central Ohio Oil Inc., September 20, 2011

Central Ohio Oil, Inc.
Process wastewater in containment area
Hose should be in containment
Scioto River Watershed
September 20, 2011
Photo by: Greg Sanders

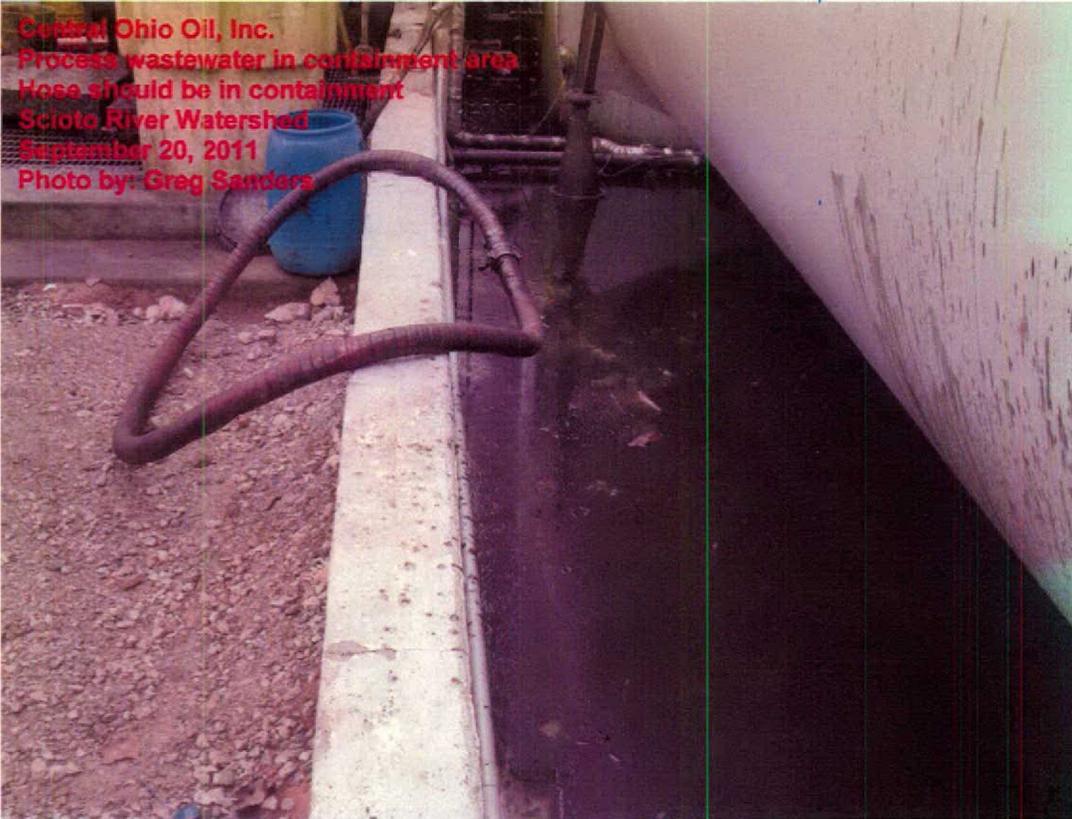


Central Ohio Oil, Inc.
Staining on gravel
Area should be in containment under roof
Scioto River Watershed
September 20, 2011
Photo by: Greg Sanders








Central Ohio Oil, Inc.
Recommends piling operation under roof
Scioto River Watershed
September 20, 2011
Photo by: Greg Sanders

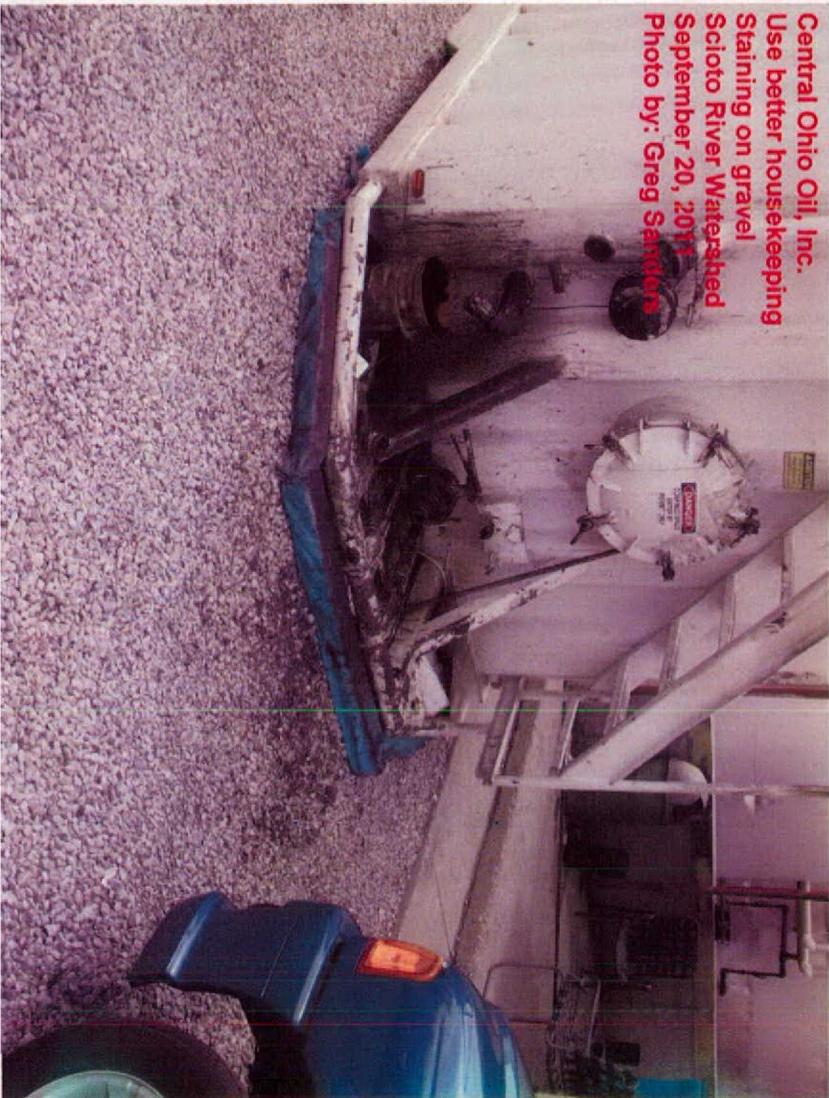


Central Ohio Oil, Inc.
Use better housekeeping
Staining on gravel
Scioto River Watershed
September 20, 2011
Photo by: Greg Sanders



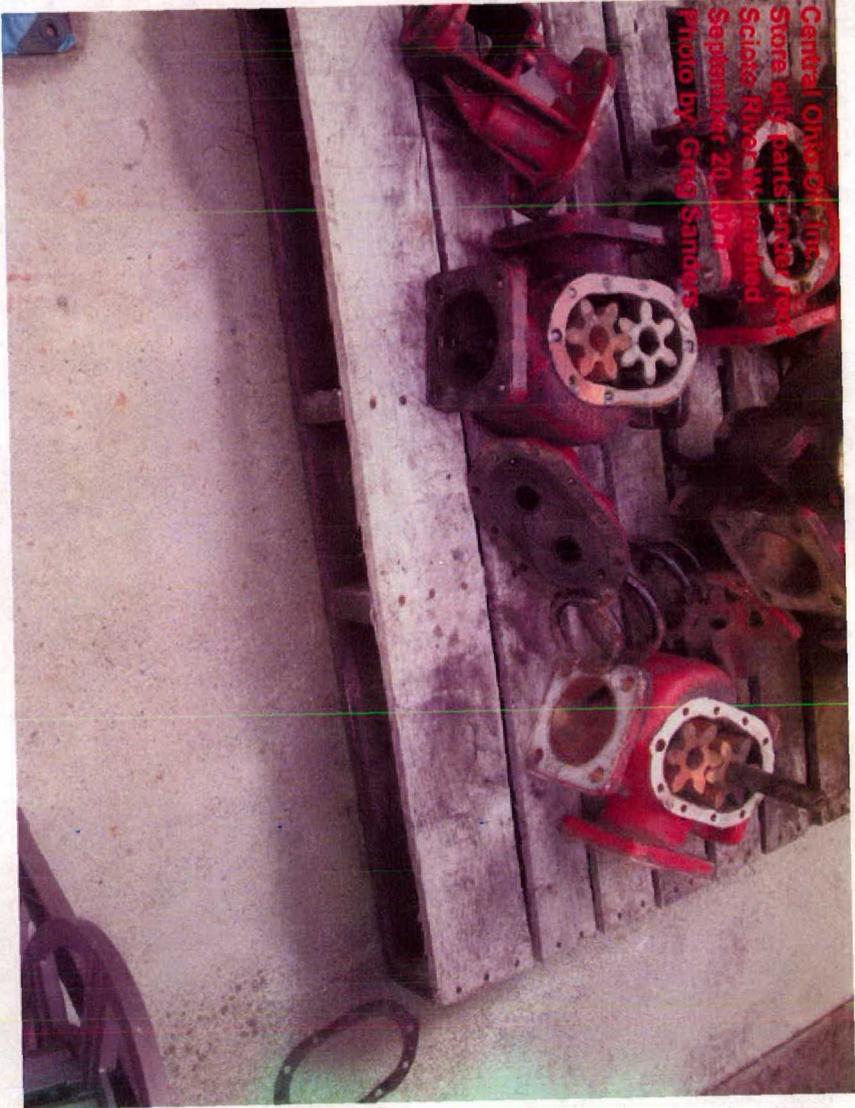

Central Ohio Oil, Inc.
Store oily parts over the
Scioto River Watershed
September 20, 2014
Photo by Greg Sanders

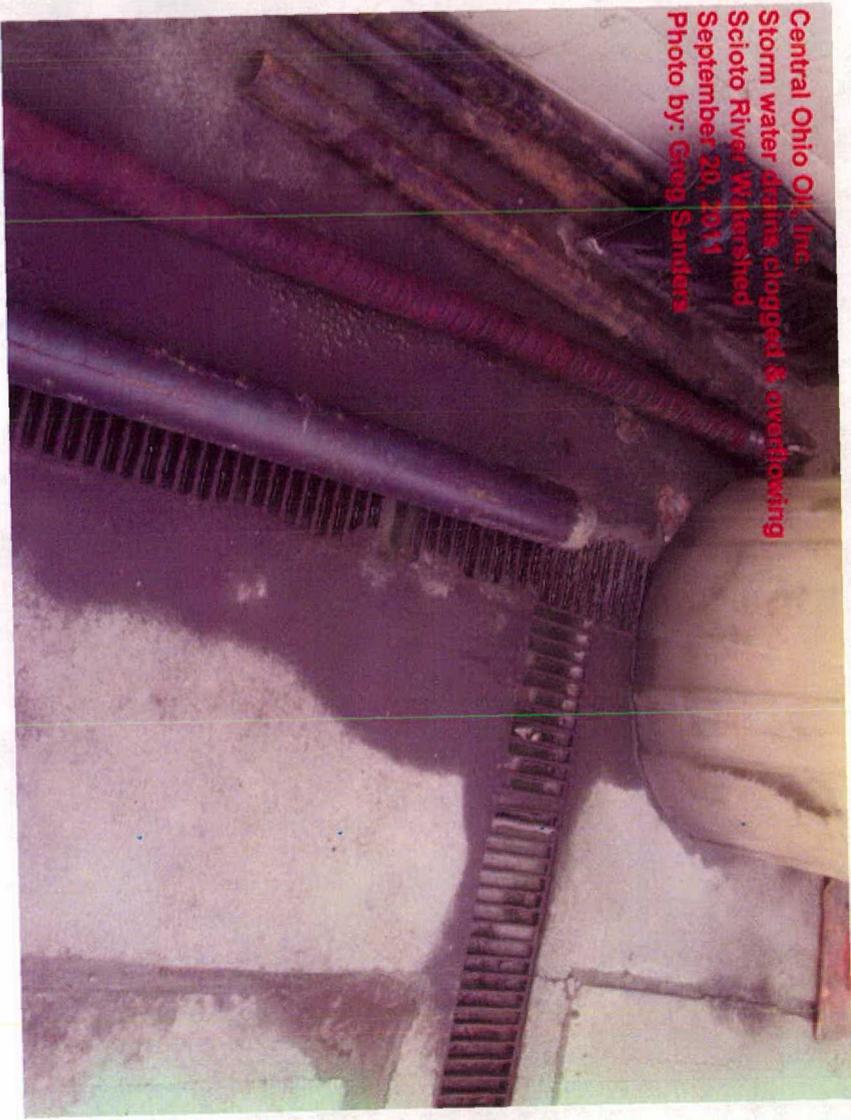

Central Ohio Oil, Inc.
Storm water drains clogged & overflowing
Scioto River Watershed
September 20, 2014
Photo by: Greg Sanders

