

2/11/09



State of Ohio Environmental



* 0 H 4 2 3 7 1 1 2 2 2 0 0 9 N O V *

STREET ADDRESS:

Central District Office

MAILING ADDRESS:

Lazarus Government Center
50 W. Town St., Suite 700
Columbus, Ohio 43215TELE: (614) 728-3778 FAX: (614) 728-3898
www.epa.state.oh.usP.O. Box 1049
Columbus, OH 43216-1049**CERTIFIED MAIL # 91 7108 2133 3932 4450 0638**

February 2, 2009

**Re: Knox County
Wyandot Golf Course
Transient Noncommunity Water
System
PWSID: 4237112**Mr. Steve Arter
Wyandot Golf Course
3032 Columbus Road
Centerburg, OH 43011

Dear Mr. Arter:

Subject: Notice of Violation for Failure to Respond to a Significant Deficiency

This letter is notification that Wyandot Golf Course has not complied with requirements issued during this Agency's last survey performed on August 25, 2008, in violation of rule 3745-81-60 of the Ohio Administrative Code. You were notified in correspondence dated September 18, 2008 to respond in writing no later than 45 days, with time frames for completion of the following items:

REQUIREMENTS:

1. The pressure tank buried at the well must be removed. Substantial changes made to any public water system without prior plan approval from this office is in violation of Ohio Administrative Code 3745-91-02(A).
2. You will need to submit detail plans to this office for your water system, we will make a determination at that time if your new softener is compatible without the greensand filters (for iron removal) that you removed since our last survey. We will also need the specifications, and purpose, of the additional tanks that are now installed on the water system. Please work with Keen Well & Pump, or any plumber you choose, to remove the buried pressure tank at the wellhead and to submit the plans for the entire system, including a determination of the nature of the tanks adjacent to the new softener.
3. Fill out the sample siting plan I left you and maintain it on site, and please send a copy of the first page to us.

Ted Strickland, Governor
Lee Fisher, Lieutenant Governor
Chris Korleski, Director


Mr. Steve Arter
Wyandot Golf Course
Page -2-

4. Install a new well cap on the well that is screened and vented and meets the requirements of Water System Council Pitless Adapter Standard PAS-97 as required by Ohio Administrative Code rule 3745-9-5. The standard the rule references can be found on the web at :
<http://www.watersystemscouncil.org/upload/standards/pitless04printed.pdf>. Your driller (Tedrow) can help you obtain one. Also, please keep the gasoline (observed during the survey) and other chemicals at least 50 from the well.
5. Ensure the backflow prevention device is inspected annually and a tag placed on the device indicating the date of inspection.
6. It appears the well casing may only be 8 feet deep, the casing depth must be verified and must be at least 25 feet in order to continue to use this well as a public water system well. The well log on file at ODNR is attached.
7. Your backflow prevention device (testable dual check valve) must be inspected on an annual basis and an inspection tag should be placed on the valve.
8. Verify in writing to this office your compliance with these requirements (or submit a schedule for compliance) within 45 days of the date of this letter. Our fax number and address are on the letterhead and my email address is: mark.boden@epa.state.oh.us.

You must respond within 15 days of the date of this letter with the required information. Failure to comply may result in further enforcement action.

Let me know if you have any questions or issues regarding your public water system. My phone number is (614) 728-3871.

Sincerely,

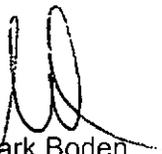

Mark Boden
Environmental Specialist
Division of Drinking and Ground Waters
Central District Office

c: Knox County Health Department
Dave Evans, DDAGW/CO