



State of Ohio Environmental Protection Agency

Northwest District Office

347 North Dunbridge Road
Bowling Green, OH 43402-9398

TELE: (419) 352-8461 FAX: (419) 352-8468
www.epa.state.oh.us

Ted Strickland, Governor
Lee Fisher, Lieutenant Governor
Chris Korleski, Director

Re: Hancock County
Findlay Animal Rescue
Construction
Storm Water

July 28, 2009

Findlay Animal Rescue
Mr. J. William Hollington
2211 Quail Lake Road
Findlay, Ohio 45840

Dear Mr. Hollington:

On July 9, 2009, I inspected the Findlay Animal Rescue project at 12405 and 12407 County Road 99, Findlay. The purpose of my visit was to ensure that the violations noted in my June 22, 2009 letter had been corrected. The site operates under the National Pollutant Discharge Elimination System (NPDES) permit for storm water discharges associated with construction activity (Construction General Permit), Facility ID No. 2GC02304. The inspection was conducted under the provisions of Ohio's water pollution control statutes, Ohio Revised Code (ORC) Chapter 6111. Ohio EPA has no record of other permittees for this site.

As a result of the inspection, I have the following comments:


1. A block foundation had been set for the building. A pond with a riser pipe had been excavated on the north side of the property.
2. The silt fence along the east side of the property was still not entrenched. *Permit Requires:* All erosion and sediment control practices used to meet the conditions of this permit should meet the standards and specifications of the current edition of Ohio's *Rainwater and Land Development Manual* (ODNR) or other standards acceptable to Ohio EPA. *This is a violation of Part III.G.2. of your permit.* The silt fence must be entrenched 4-6 inches, with the trench backfilled and the soil compacted.
3. A stone construction entrance was in place and there was no tracking.
4. An extended detention basin had recently been excavated on the north side of the site. The outlet was a riser pipe, surrounded with stone. A sediment settling pond is required for the site. It appears to be designed to be a sediment settling pond.
5. The pit at the south end of the property was still there. Although it was partially filled in, there was still woody debris protruding from the pit.



Mr. J. William Hollington
July 28, 2009
Page Two

Within 10 days of the date on this letter, please submit to this office **written notification** as to the actions taken or proposed to prevent any future violations. Your response should include the dates, either actual or proposed, for the completion of the actions. If there are any questions, please contact me at (419) 373-3006 or Lynette Hablitzel at (419) 373-3009.

Sincerely,

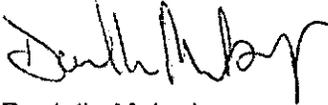

Danielle Meienburg
Division of Surface Water
Storm Water Program

/lb

pc ~~NWD/OT/ETB~~
Craig Spoon, Millstream Building Systems
Steven Wilson, P.E., P.S., Hancock County Engineer
Gary Tuttle, Hancock County SWCD