




Environmental
Protection Agency

John R. Kasich, Governor
Mary Taylor, Lt. Governor
Scott J. Nally, Director

OH8733412

WOLF AMLC

7/8/2011

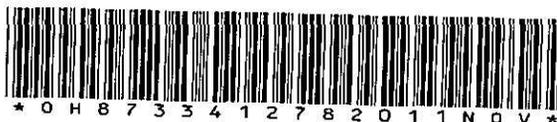

Re: Wood County
TNC - AMLC
Wolf AMLC
PWS ID# OH 8733412
STU ID# 8759943

July 8, 2011

Mr. Jim Wolf
11367 Five Point Road
Perrysburg, Ohio 43551

Dear Mr. Wolf:

Subject: Notice of Violation for Failure to Respond to a Significant Deficiency

This letter is notification that the Wolf AMLC has not complied with requirements issued during this Agency's last survey performed on May 31, 2011, in violation of rule 3745-81-60 of the Ohio Administrative Code. **The PWS was notified in correspondence dated June 02, 2011, to respond in writing no later than 30 days, with time frames for:**

- 1.) OAC Rule 3745-9-05 (P) states "Electrical conduit connections on the well cap or seal shall be threaded and sealed to prevent the entrance of insects and water."

The well does not have the appropriate conduit seal on the cap. Install a cap that includes a conduit connection that meets OAC Rule 3745-0-05 (P).

- 2.) OAC Rule 3745-9-05 (T) states "A vent shall be provided on all well caps and seals...A well vent shall be self-draining, screened with a non-corroding mesh screen of fifteen to thirty mesh, pointed downward at or above the top of the casing or pitless unit. A vent shall terminate not less than twelve inches above ground surface."

The well does not have an appropriate vent on the cap. Install a cap with a vent that meets the specifications identified in OAC 3745-9-05 (T).

- 3.) OAC Rule 3745-95-04 (A) states "An approved backflow prevention device shall be installed on each service line to a consumer's water system serving premises, where in the judgment of the supplier of water or the director, a pollutional, system, health or severe health hazard to the public water system exists."


Mr. Jim Wolf
July 8, 2011
Page 2

Ensure that an approved backflow prevention device is installed on each service line where a pollutional or health hazard to the public water system exists. Such a device should be installed on the external hose bib, wash room hose bib, and spigot at well.

The water system must respond in writing within 15 days from the date of this letter with the required information. Failure to comply may result in further enforcement action.

If you have any questions regarding this letter, or any other matter involving your water system, contact me at 419-373-3101.

Sincerely,

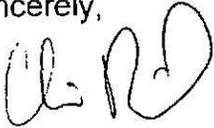

Chris Riddle
Environmental Specialist 2
Division of Drinking and Ground Waters

/l/r

pc: Wood County Health Department
OEPA Central Office, DDAGW
~~DDAGW;NWDO:File~~