

7004 2510 0004 5044 7531

U.S. Postal Service™
CERTIFIED MAIL™ RECEIPT
(Domestic Mail Only; No Insurance Coverage Provided)

For delivery information visit our website at www.usps.com

OFFICIAL USE

Postage	\$
Certified Fee	
Return Receipt Fee (Endorsement Required)	
Restricted Delivery Fee (Endorsement Required)	
Total Postage & Fees	\$

Postmark
Here

Sent To: THOMAS POWERS, PARSONE
 Street, Apt. No.,
 or P.O. Box No. PARSONS PARTNERSHIP
 City, State, ZIP+4 919107



State of Ohio Environmental Protection Agency

Northeast District Office

2110 East Aurora Rd.
Twinsburg, Ohio 44087

TELE: (330) 963-1200 FAX: (330) 487-0769
www.epa.state.oh.us

Ted Strickland, Governor
Lee Fisher, Lieutenant Governor
Chris Korleski, Director

September 19, 2007

RE: SUMMIT COUNTY
BATH TOWNSHIP
CLEARVIEW INN
COMPLIANCE EVALUATION INSPECTION
NPDES NO. 3PR00360

NOTICE OF VIOLATION

CERTIFIED MAIL

Mr. Thomas Poinar, Owner
Parsons-Poinar Partnership
2446 N. Cleveland-Massillon Road
Akron, OH 44333

Dear Mr. Poinar:

On September 11, 2007, a Compliance Evaluation Inspection (CEI) was conducted at the above referenced wastewater treatment plant. The inspection was prompted after receiving a poor inspection report from the Summit County Health Department.

The aeration treatment plant was running and appeared to be the proper chocolate brown color. The clarifier was full of solids, and must be pumped out as soon as possible. The dosing station appeared to be broken with ponded water surrounding it; the dosing station must be repaired immediately. It appeared that the surface sand filter was being bypassed, which is not permissible. The chlorination/dechlorination tank, which should contain clear water, contained lots of solids and brown foam. Please be aware that a discharge of partially treated wastewater onto the ground surface is not only in violation of Ohio Revised Code 6111, but could pose a health risk to someone who may come in contact with it. In conclusion, the plant was operating poorly, needs repaired, and requires better maintenance.


Review of the self monitoring reports from August 2005 through August 2007 revealed the following numeric effluent violations:

Reporting Period	Parameter	Limit Type	Limit	Reported Value	Violation Date
March 2007	Total Suspended Solids	30D Conc	12	23.	3/1/2007
March 2007	Total Suspended Solids	7D Conc	18	23.	3/15/2007
August 2006	Chlorine, Total Residu	1D Conc	0.019	.2	8/24/2006
December 2005	CBOD 5 day	30D Conc	10	22.	12/1/2005
June 2006	Total Suspended Solids	30D Conc	12	13.	6/1/2006
June 2006	Dissolved Oxygen	1D Conc	6.0	2.8	6/3/2006
June 2007	Total Suspended Solids	30D Conc	12	31.	6/1/2007
June 2007	Total Suspended Solids	7D Conc	18	31.	6/22/2007
June 2007	Chlorine, Total Residu	1D Conc	0.019	.17	6/25/2007

Mr. Thomas Poinar
Clearview Inn
September 19, 2007
Page 2

Please be advised such instances of noncompliance are subject to enforcement pursuant to ORC 6111. Please notify this office by September 25, 2007 of your intent to address the aforementioned violations. Once a certified septic company and/or your technical operator repairs the plant, contact this office so that a follow-up inspection may be conducted. If you have any questions, please contact me at (330) 963-1151.

Sincerely,

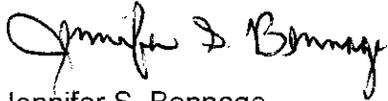

Jennifer S. Bennage
Environmental Engineer
Division of Surface Water

JSB/mt

cc: Owner, Clearview Inn Steak and Chop House