

Planning and moving forward

Bob Taft, Governor
Randy Taylor, Lt. Governor
Scott J. Nally, Director

July 28, 2013

Shain Buerk
Buerk- Pickerington Land Development LLC
7313 International Drive Suite B
Holland, OH 43528

**Re: Storm Water Inspection at Diley Crossroads/ Fairfield County. Permit #:
4GC03963*AG**

Dear Mr. Buerk:

This letter is written in follow up to a construction storm water inspection by Jerome Hoke and Paul Hafner of the Ohio EPA, at Diley Crossroads located at the southwest corner of Hill Road and relocated Diley Road on July 2, 2013. The purpose of the inspection was to evaluate compliance with Ohio EPA's General Storm Water Permit Associated with Construction Activities. During the inspection, we noted the following:

Sediment and Erosion Controls

- There appear to be no sediment or erosion controls on the west side of the site. Please implement these controls immediately to ensure compliance with the General Storm Water Permit.
- Stabilization is required along the drainage ditch on the west side of the site to minimize offsite sedimentation (See Figure 1).

Sediment Pond

- During the inspection, our staff noted that the sediment pond on the east side was not yet modified for sediment control (See Figure 2). As stated in a previous letter from June 17, 2013, the impoundment **must incorporate a temporary riser or skimmer** or demonstrate an approvable alternative. **Corrective measures are expected within three days from receipt of this letter.** The riser must be set to an elevation to accommodate the required storage of 67 cubic yards per acre of drainage for the dewatering zone and thirty seven (37) cubic yards per acre of disturbance for the sediment settling zone. Please refer to the following link for assistance:

<http://www.dnr.state.oh.us/water/rainwater/default/tabid/9186/default.aspx>

Shain Buerk
Buerk- Pickerington Land Development LLC
Page 2

If you have any questions regarding this letter or the inspection, please do not hesitate to call me at our Central District Office at (614) 728-3844 or email at harry.kallipolitis@epa.state.oh.us. In addition, please provide a written response (**email preferred**) to the action items addressed above within ten days from receipt of this letter. A follow-up inspection will be conducted to ensure the minimum conditions of the General Permit have been met.

Sincerely,


A handwritten signature in black ink, appearing to read 'H. Kallipolitis', with a stylized flourish at the end.

Harry Kallipolitis
Storm Water Coordinator
Ohio EPA, Division of Surface Water
Central District Office



Diley Crossroads
Blackfox Creek Watershed
Photo by Jerome Hoke
7.2.13

Figure 1: Drainage ditch on the west side requires stabilization.

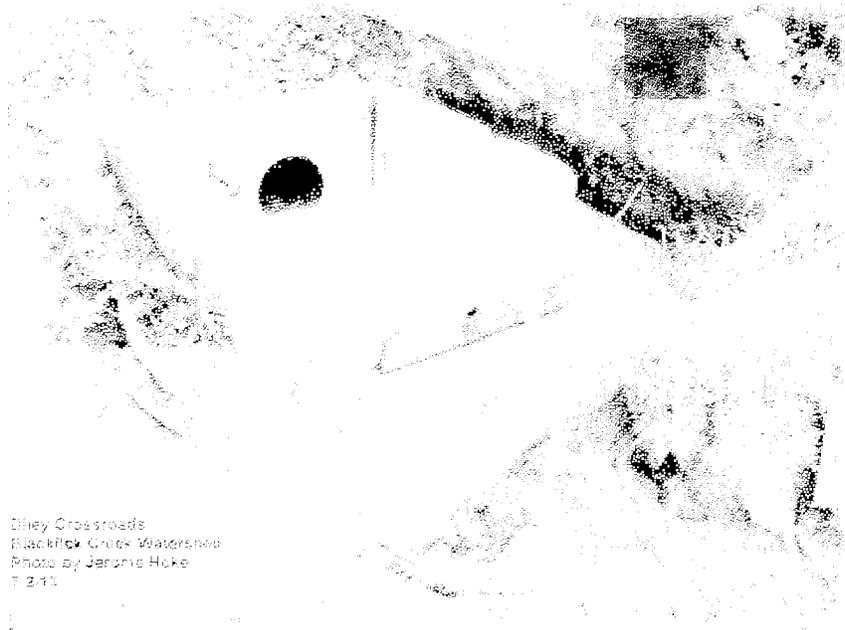

Diley Crossroads
Blackfox Creek Watershed
Photo by Jerome Hoke
7.2.13

Figure 2: Sediment controls for pond on east side of site remain incomplete.