




State of Ohio Environmental  
Northeast District

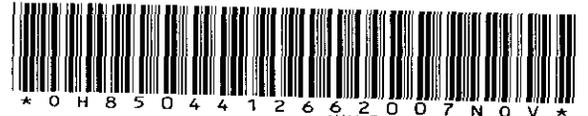

\* 0 H 8 5 0 4 4 1 2 6 6 2 0 0 7 N O V \*

2110 East Aurora Rd.  
Twinsburg, Ohio 44087

TELE: (330) 963-1200 FAX: (330) 487-0769  
www.epa.state.oh.us

Lee Fisher, Lieutenant Governor  
Chris Korleski, Director

June 6, 2007

RE: WAYNE COUNTY  
WESTVIEW MOBILE HOME PARK  
COMMUNITY WATER SYSTEM  
PWS ID # OH8504412  
STU 1 ID # 8559623  
STU 2 ID # 8560623

Mrs. Florence Schreibman  
P.O. Box 305  
Chagrin Falls, OH 44022

CERTIFIED MAIL

**Subject: Notice of Violation for Failure to Respond to a Significant Deficiency**

Dear Mrs. Schreibman:

This letter is notification that the Westview Mobile Home Park PWS has not complied with requirements issued during this Agency's last survey performed on March 8, 2007, in violation of rule 3745-81-60 of the Ohio Administrative Code. Westview Mobile Home Park PWS was notified in correspondence dated April 6, 2007 to respond in writing no later than 45 days, with time frames for:

**REQUIREMENT(S)**

1. Well Cap and Conduit - During the survey we noted that your Well 1 cap and conduit were cracked and broken. According to OAC 3745-9-05 (P), "a well shall have a well cap or seal to prevent the entrance of water, dirt, animals, insects, or other foreign matter. The top of the casing at its finished height shall be cut so that the surface will fit flush with the well cap and provide a tight seal. The well cap or seal shall fit securely to the top of the well casing, be secured with screws or other appropriate connections, and vent to the atmosphere. Electrical conduit connections on the well cap or seal shall be threaded and sealed to prevent the entrance of insects and water. A well cap for a public water system well shall conform with "Water System Council Pitless Adapter Standard PAS-97, Performance Standards for Sanitary Water Well Pitless Adapters, Pitless Units, and Watertight Well Caps" (1997), or with an alternative standard acceptable to the director."

Please provide Well 1 with a new, appropriate well cap and fix the conduit. The cap for Well 2 was loose and probably would not seal enough to prevent the entrance of contaminants. The caps for Wells 2 and 4 should both be evaluated. If they do not conform with the criteria of the previous paragraph, then these caps should be replaced, as well.

2. Chlorine Test Kit - During the survey, we noted that you are not using a digital display chlorine test kit. According to OAC 3745-81-27(C)(1)(a), "residual disinfectant concentrations for free chlorine and combined chlorine may be measured by using DPD colorimetric test kits. A DPD colorimetric test kit acceptable to the director is one that uses electronic measurement of the color development. It shall also have a digital display of the result. DPD colorimetric test kits with an analog display are not acceptable for use. An acceptable DPD colorimetric test kit shall have a method detection limit of 0.1mg/l."

Please purchase and begin to use a DPD colorimetric test kit as described above.


#### **RECOMMENDATION(S)**

1. Source Water Assessment - The 1996 Amendments to the Safe Drinking Water Act require Ohio EPA to conduct source water assessments for all public water systems. The assessment of your water system will assist you in identifying the potential threats to your water supply, and help you develop protective strategies for your water supply. A SWAP report was issued to Westview MHP on June 13, 2003. This report contains a checklist of protective strategies for contaminant sources identified within the report. The report identified your source as having a HIGH susceptibility to contamination. Please review the report and complete the checklist of protective strategies. Return the checklist to this office within 45 days of this letter date. Specific questions that you may have about the SWAP report can be answered by contacting Kathy Metropulos at (330) 963-1149.

**The water system must respond in writing within 15 days from the date of this letter with the required information.** Failure to comply may result in further enforcement action.

If you have any questions, please contact me at (330) 963-1194.

Sincerely,

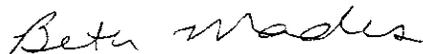

Beth Madis  
Environmental Specialist  
Division of Drinking and Ground Waters

BRM/ams

cc: Wayne County Health Dept.  
Dave Evans, Ohio EPA, Central Office, DDAGW  
Denny White, Village of Doylestown