



State of Ohio Environmental Protection Agency

STREET ADDRESS:

Lazarus Government Center
50 W. Town St., Suite 700
Columbus, Ohio 43215

Central District Office

TELE: (614) 728-3778 FAX: (614) 728-3898
www.epa.state.oh.us

MAILING ADDRESS:

P.O. Box 1049
Columbus, OH 43216-1049

September 17, 2010

Steve Wolf
Kirco Manix Construction
6530 West Campus Oval, Suite 270
New Albany, OH 43054

Re: 1061 Mill Park Drive / Fairfield County

Dear Mr. Wolf:

This letter is written regarding the storm water inspection I conducted of the construction activities at the project located at 1061 Mill Park Drive, on September 10, 2010. I understand this site is currently covered under the General Storm Water Permit Associated with Construction Activities. Based on my site inspection and the conditions set forth in the General Permit, the following items must be addressed:

Sediment and Erosion Controls:

The project site had several large barren areas that appeared to be at final grade and were not stabilized. Please see attached pictures. Please be aware the General Permit mandates specific permanent and temporary stabilization requirements. All disturbed areas which remain idle in excess of 21 days must be protected from erosion within seven days of the last earth disturbing activities. All areas of final grade must be protected within seven days. All earth disturbing activities should be clearly logged in your inspection reports to ensure the 21 day / seven day requirement is not violated.

Silt fence appeared to be installed along Mill Park Drive but not along the sides of the building. Silt fence was not maintained along Mill Park Drive. Silt fence was being used as a check dam in the ditch, however, the silt fence was not installed in the ground to be effective. The General Permit requires the permittee to conduct inspections of all sediment and erosion controls every seven days or within 24 hours of a rain event equal to or greater than 0.5 inches. A log of the inspections and resulting corrective actions must be maintained on site available for review. All earth disturbing activities must be clearly documented in your inspection reports to ensure the temporary or permanent stabilization requirements are not violated. Please see attached pictures.

During the site visit, it was noted that wastewater from a floor scrubber was being discharged to a sidewalk and ditch which flowed to waters of the State. The floor scrubber wastewater appeared to contain surfactants, solvents and a lot of suspended solids. Please be aware that it is illegal to discharge pollutants to waters of the state without first obtaining a permit. A permit would not be issued for this type of activity. This is a violation of state and federal law. The explanation given at the site for the reason why industrial wastewater was discharged to waters of the state was that they had not received approval to discharge to their sanitary sewers. Please see attached pictures.

Ted Strickland, Governor
Lee Fisher, Lieutenant Governor
Chris Korleski, Director



Steve Wolf
Kirco Manix Construction
Page -2-

During the site visit, it was noted that a large amount of water from the testing of the fire suppression system was discharged across a barren area and the sediment was being discharged to a storm water drain on the adjacent property. The discharge of sediment off-site is a violation of your General Storm Water Permit Associated with Construction Activities. The fire suppression test water must be discharged directly to the storm water drain or a large grassy area (assuming it is clean water free of pollutants). The barren areas must be stabilized. Please see attached pictures.

If you have any questions regarding this letter or my inspection, please do not hesitate to call me at our Central District Office at (614) 728-3851.

Sincerely,




Gregory L. Sanders
Environmental Specialist
Stormwater Section
Division of Surface Water
Central District Office


Enclosure

c: Jeff Bohne, DSW/CDO
Bob Muckensturm, SRI
Serigraphie Richford Inc.
Jason Westfall, City of Lancaster


GLS/nsm 1061 Mill Park Drive, September 10, 2010

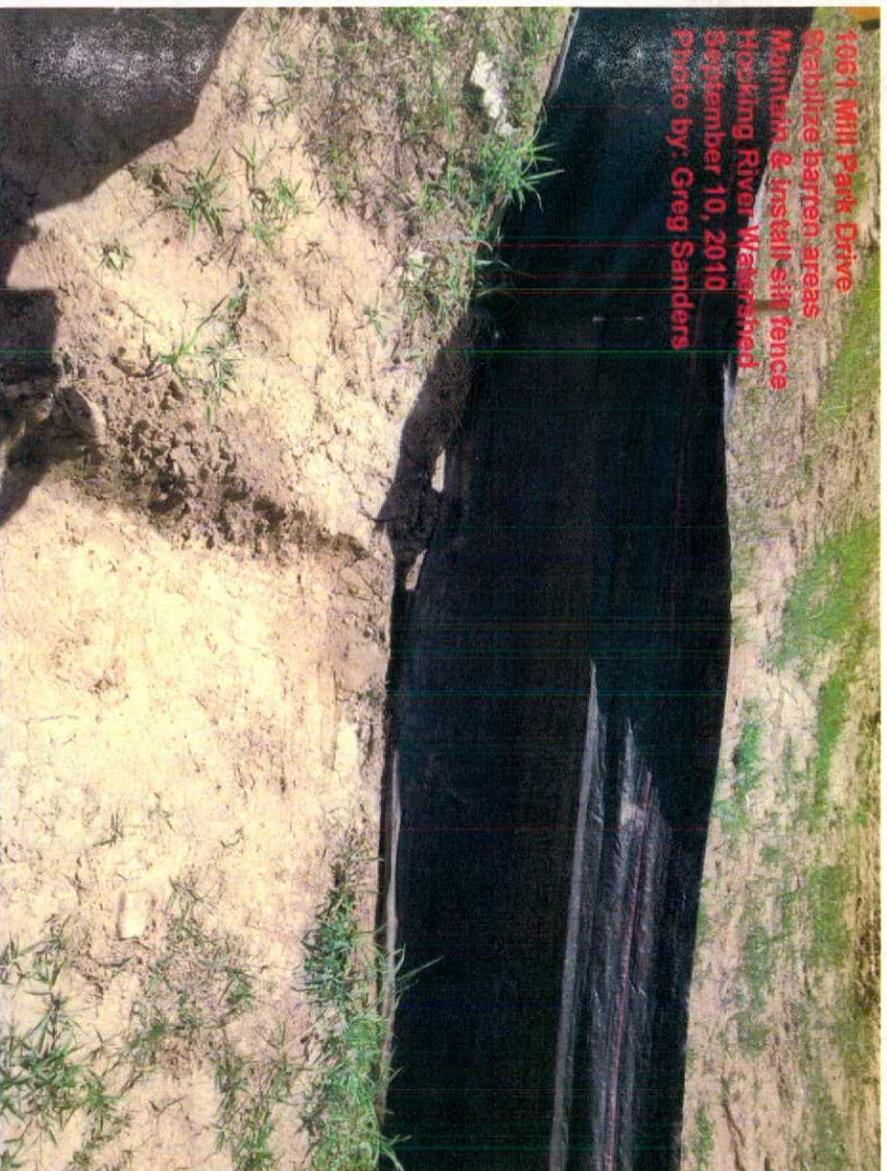


1061 Mill Park Drive
Stabilize barren areas
Maintain & install silt fence
Hocking River Watershed
September 10, 2010
Photo by: Greg Sanders

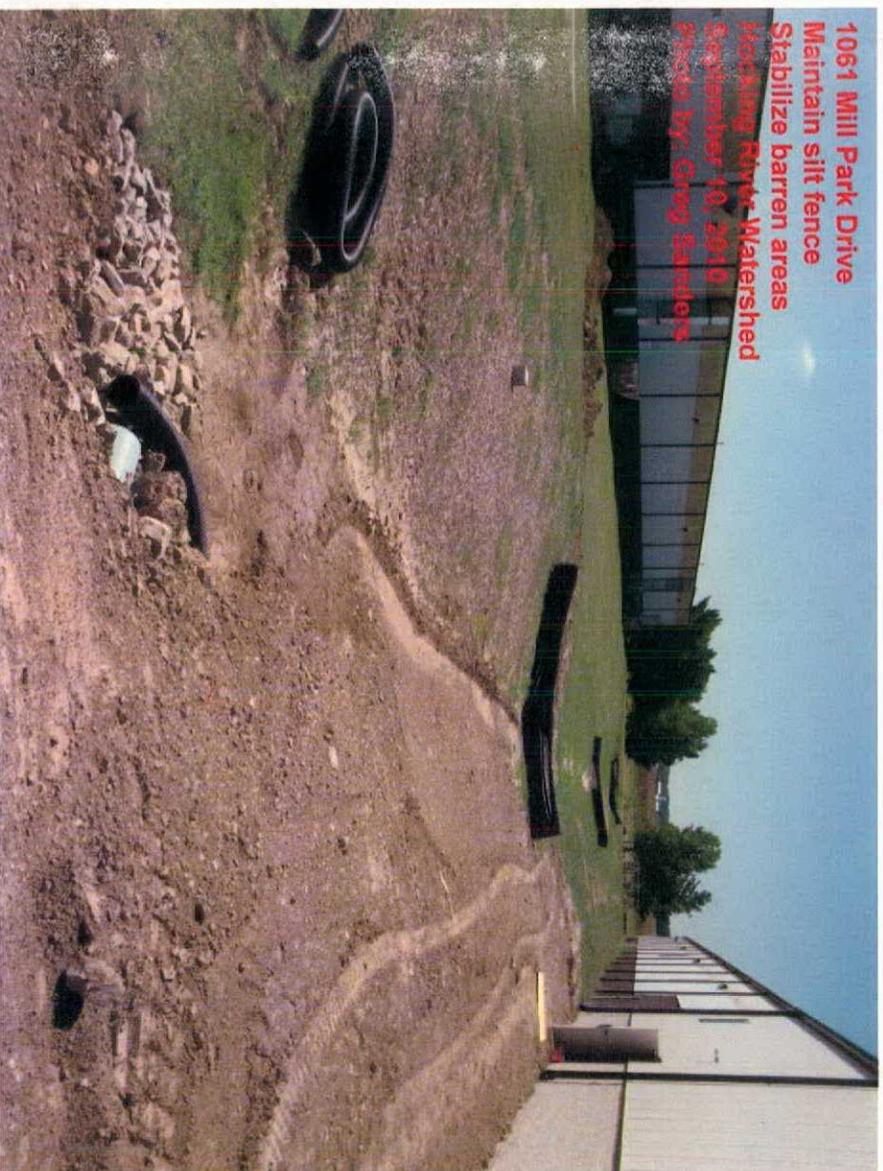

1061 Mill Park Drive
Maintain silt fence
Stabilize barren areas
Hocking River Watershed
September 10, 2010
Photo by: Greg Sanders




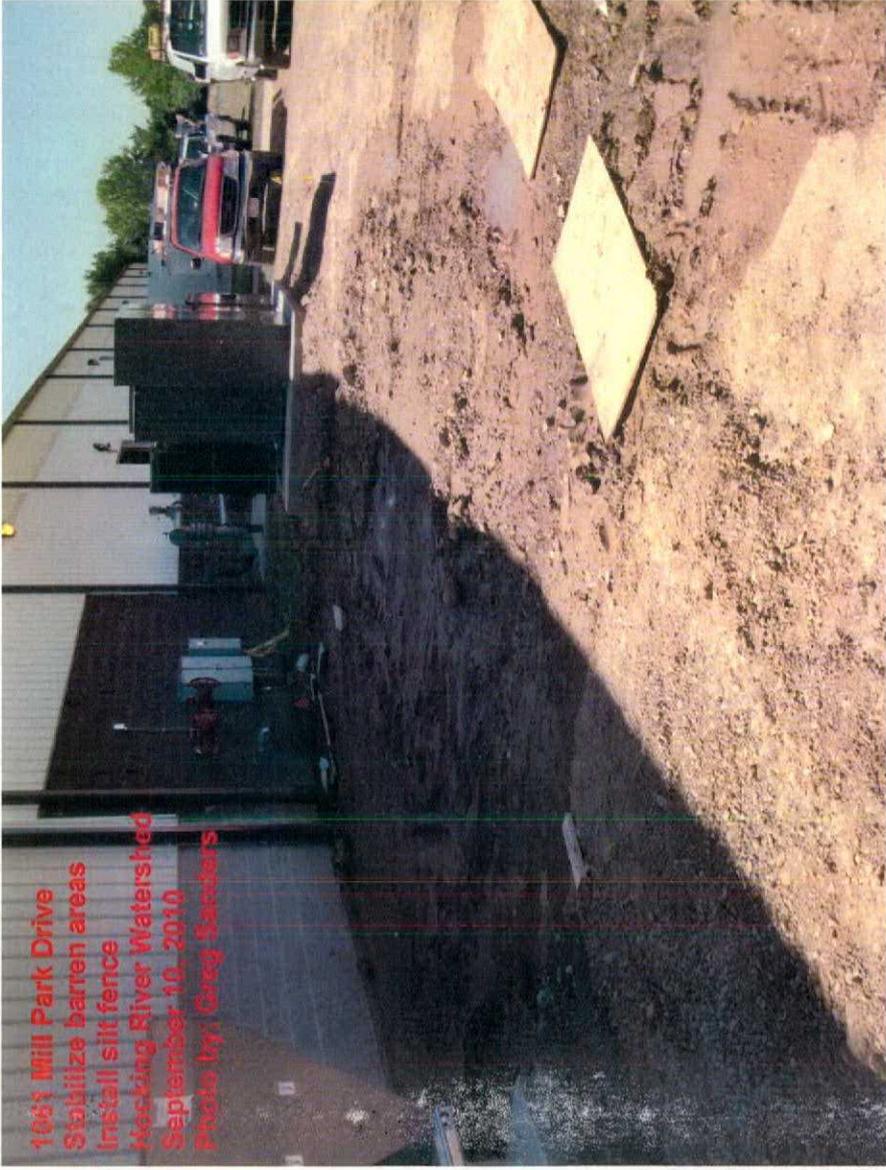

1051 Mill Park Drive
Stabilize barren areas
Install silt fence
Attocking River Watershed
September 10, 2010
Photo by: Greg Sanders



1051 Mill Park Drive
Best discharge to waters of the state
Attocking River Watershed
September 10, 2010
Photo by: Greg Sanders



1061 Mill Park Drive
Floor scrubbers wastewater discharged to ditch
illicit discharge to waters of the state
Hocking River Watershed
September 10, 2010
Photo by: Greg Sanders



1061 Mill Park Drive
Floor scrubber wastewater discharged to ditch
Hocking River Watershed
September 10, 2010
Photo by: Greg Sanders

