



4GC0339820110815

2011/08/15

4GC03398

UNIVERSAL DESIGN LIVING LABORATORY



Environmental
Protection Agency

John R. Kasich, Governor
Mary Taylor, Lt. Governor
Scott J. Nally, Director

August 15, 2011

Mark Leder
Rossetti Enterprises Inc.
6141 Clark State Road
Columbus, OH 43230

**Re: Construction Storm Water Inspection at Universal Design Living Laboratory / Franklin County
Permit Number: 4GC03398 *AG**

Dear Mr. Leder:

This letter is written regarding a storm water inspection conducted by Daelann Farnlacher and Greg Mann of the Ohio EPA at Universal Design Living Laboratory located at 6141 Clark State Road Columbus, Ohio on July 18, 2011. The purpose of the inspection was to evaluate compliance with the General Storm Water Permit Associated with Construction Activities. During the inspection, our staff noted the following issues associated with construction activities at this site:

Sediment and Erosion Control:

- Sediment is bypassing the bales of hay intended for sediment control (See Figure 1). Corrective measures must be implemented within three days of receipt of this letter.
- The silt fence along the back and left side of the site has failed and requires reinstallation (See Figures 2 and 3).
- Be aware the General Permit states that all barren areas which remain idle in excess of 21 days must be protected from erosion within seven days of the last earth disturbing activities. In addition, erosion protection must be implemented for all areas of final grade within seven (7) days (See Figure 4).

Post Construction Requirements:

- The General Storm Water Permit requires specific post construction water quality treatment for all sites. Guidance regarding the post construction requirements is found at: <http://www.epa.state.oh.us/dsw/storm/CGPPCQA.aspx>. Please submit to my attention (email preferred at harry.kallipolitis@epa.state.oh.us) which practice will be installed at this site to ensure compliance with the General Permit. Please include all design criteria and calculations in your submission.

Central District Office
50 West Town Street, Suite 700
P.O. Box 1049
Columbus, OH 43216-1049

614 | 728 3778
614 | 728 3898 (fax)
www.epa.ohio.gov

Mark Leder
Rossetti Enterprises Inc.
Page -2-

If you have any questions regarding this letter or the inspection, please do not hesitate to contact me at our Central District Office at 614-728-3844 or email at harry.kallipolitis@epa.state.oh.us. In addition, please provide a written response (***email preferred***) to the action items addressed above within ten days from receipt of this letter. A follow-up inspection will be conducted to ensure the minimum conditions of the General Permit have been met.

Sincerely,

A handwritten signature in cursive that reads "J Boh" with "for HK" written below it.

Harry Kallipolitis
Storm Water Coordinator
Division of Surface Water
Central District Office

c: Jeff Bohne, Water Quality Supervisor, DSW / CDO

HK/nsm Universal Design Living Laboratory 7-18-2011





Figure 3: Failed silt fence

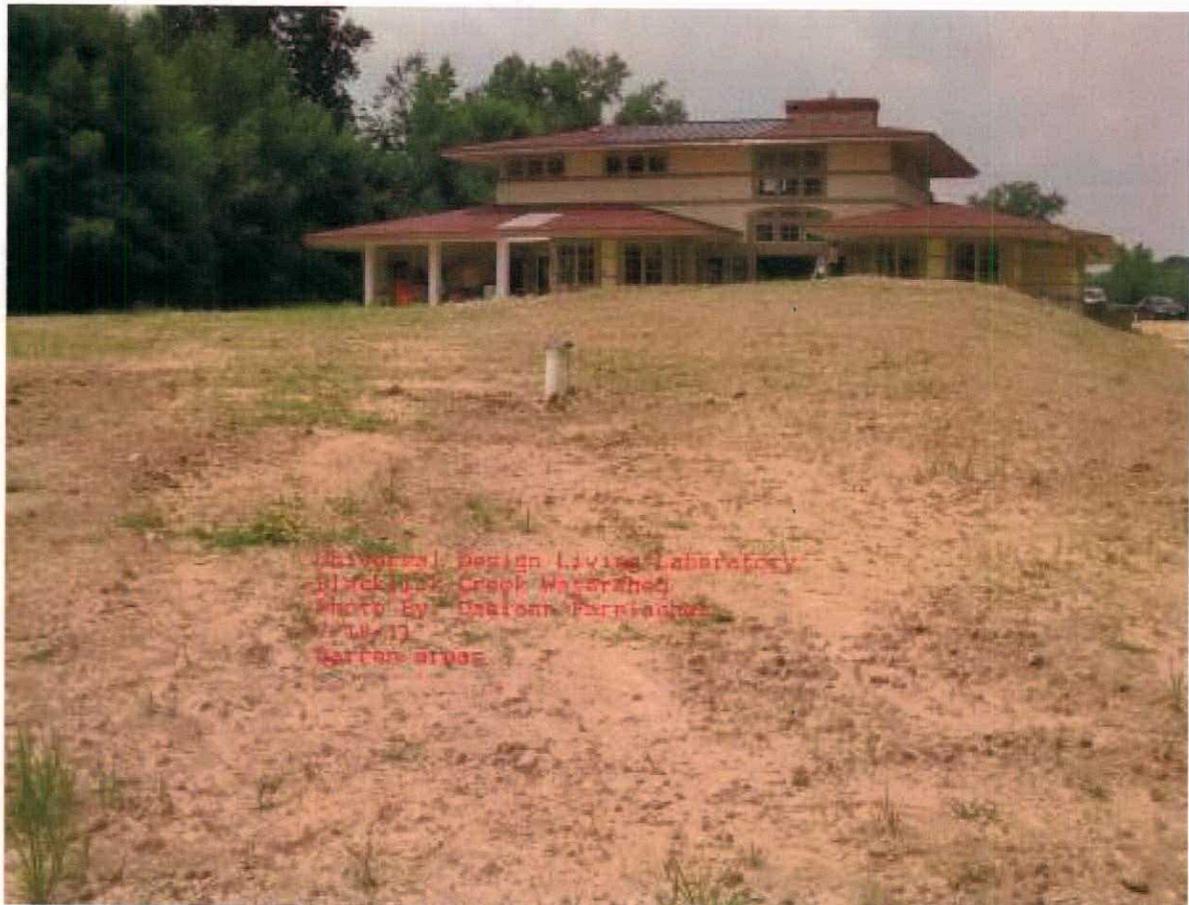


Figure 4: Barren areas

