

**Environmental  
Protection Agency**

Governor  
Lt. Governor  
Director

July 26, 2011

RE: MEDINA COUNTY  
VILLAGE OF WESTFIELD CENTER  
WESTFIELD CENTER COMM. PARK  
NPDES PERMIT NO. OHC000003  
OHIO EPA PERMIT NO. 3GC04973\*AG  
CONSTRUCTION STORM WATER

GGJ Inc.  
35585 Curtis Blvd.  
Eastlake, OH 44094

Dear Sirs:


On July 20, 2011, Ohio EPA conducted an inspection of the Westfield Center Community Park project located at Leroy Rd. & US 224, Village of Westfield Center, Medina County. Ohio EPA records indicate that the site is covered by the General National Pollutant Discharge Elimination System (NPDES) Permit for Storm Water Associated with Construction Activity (General Storm Water Permit), permit No. 3GC04973\*AG. The inspection documented the following:

- **There was excessive erosion on the embankment of the sediment basin.**
  - Please fill in any eroded channels and re-stabilize these areas immediately (See Figure 1).
- **There were signs of concrete washout on disturbed soil.**
  - Concrete wash water is considered waste water and must be treated as such. If concrete is to be washed out on site in the future, please install a designated concrete wash out pit on site to prevent the waste water from being in contact with stormwater runoff (See Figure 2).
- **There appeared to be areas of the site that will remain idle for twenty one (21) days or greater.**
  - If this is the case, please stabilize these areas immediately with seeding and straw mulch (See Figure 3).
- **The site appeared to be near completion.**
  - Once the site is finished and is permanently stabilized, please convert the temporary dewatering structure (riser pipe) and outlet structure for the sediment basin to its post construction function. Until then, the riser pipe needs to be capped on top (See Figure 4). Within forty five (45) days of stabilizing the site and converting the sediment basin, please be sure to submit a Notice of Termination (NOT) form to terminate the permit for the site.

GGJ Inc.  
Westfield Center Comm. Park  
July 26, 2011  
Page 2

Please provide me with a letter of response indicating the actions you will take to address the deficiencies noted above. Your response must be received and corrective action completed by August 8, 2011. If corrective action cannot be completed by this date, your response should include the date by when corrections will be completed. Also, please fax a copy of your most recent storm water inspection report to my attention at (330) 487-0769 or via e-mail at [timothy.mcparland@epa.state.oh.us](mailto:timothy.mcparland@epa.state.oh.us). Should you have any questions regarding this matter, please contact me at your earliest convenience at (330) 963-1128.

Sincerely,

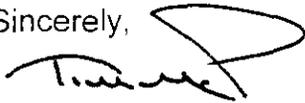

Tim McParland  
Assistant to the District Engineer  
Division of Surface Water

TM/mt

cc: Medina SWCD  
Thomas Horwedel, Village of Westfield Center, Mayor

ec: Chris Moody, DSW, NEDO



Figure 1. The embankment is eroding badly.

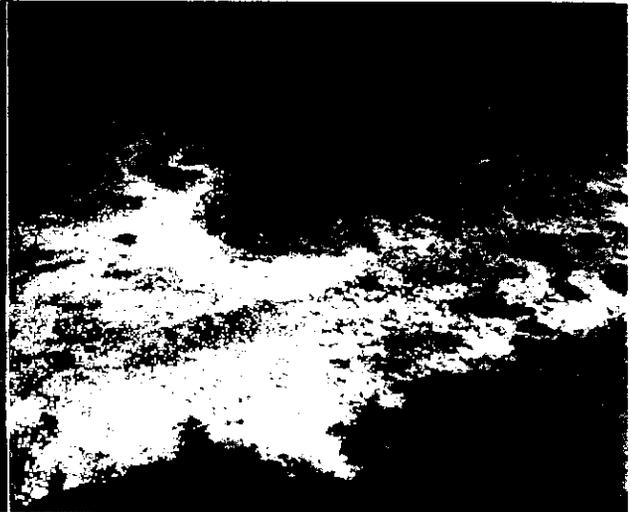


Figure 2. Concrete wash out on exposed soil.



Figure 3. Please stabilize areas idle for greater than 21 days.

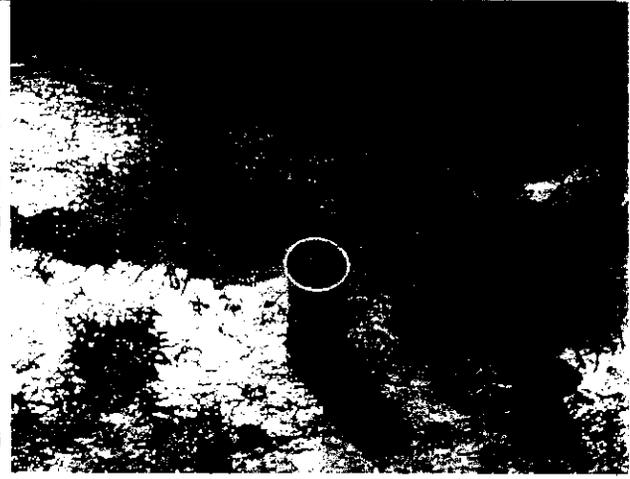


Figure 4. The sediment basin needs to be converted to its post construction function once the site is complete and stable. Until then, the riser pipe needs to be capped.