



State of Ohio Environmental Protection Agency

Northeast District Office

2110 East Aurora Rd.  
Twinsburg, Ohio 44087

TELE: (330) 963-1200 FAX: (330) 487-0769  
www.epa.state.oh.us

Ted Strickland, Governor  
Lee Fisher, Lieutenant Governor  
Chris Korleski, Director

May 19, 2008

RE: PLEASANT VIEW NORTH  
451 VALLEY ROAD  
BUTLER TWP.  
COLUMBIANA COUNTY

Mr. Tim Chesney  
Jilltin Management Group, LLC  
888 Boardman-Canfield Rd., St A  
Boardman, OH 44512

**NOTICE OF VIOLATION**

Dear Mr. Chesney:

On April 4, 2008, this writer conducted an inspection of the wastewater treatment plant for the Pleasant View North Retirement & Rehabilitation Center. The facility was represented by Mrs. Liz Shutler. The intent of the inspection was to evaluate operations and maintenance of the system. This facility is currently considered to be in significant noncompliance. The following are findings from the inspection.

1. The facilities consist of a trash trap, followed by a flow equalization tank, 17,500-gpd extended aeration treatment plant, dosing chamber, surface sand filter, and chlorination/dechlorination facilities. The solids handling facilities include an aerated sludge holding tank and sludge drying beds. At the time of the inspection, the trash trap appeared satisfactory. The aeration tank had a weak color and was receiving marginal amount of air. One of the air lines appeared partially plugged. Biological activity in the tank appeared minimal. The settling tank was grey and solids were going over the weir.
2. The surface sand filters were plugged and overflowing the walls. This is an unauthorized discharge and violation of your NPDES permit and chapter 6111 of the Ohio Revised Code.
3. Since the permit went effective in August 1, 2007, several monthly operating reports are missing. There are no reports for the following: August 07, November 07, December 07, March 08, and April 08. Two significant violations were documented for suspended solids (monthly and weekly) in January 2008.
4. Photographs of the inspection are attached.

By June 4, 2008, please respond in writing what steps have been taken to return the treatment plant to compliance. The letter must discuss changes to the plant and address the monitoring and reporting violations. Failure to correct these violations could result in additional enforcement actions.

You may contact this office at (330) 963-1193 to discuss any questions you may have.

Respectfully,

Joseph E. Trocchio, P.E.  
Environmental Engineer  
Division of Surface Water

JET/mt


cc: Columbiana County Health Dept.  
Liz Shutler

File: Semipublic/Columbiana County/Butler Township/Pleasant View North

WEST BRANCH NURSING HOME INSPECTION PHOTOS




Sand filter is plugged and overflowing. This is an unauthorized discharge of the treatment system.

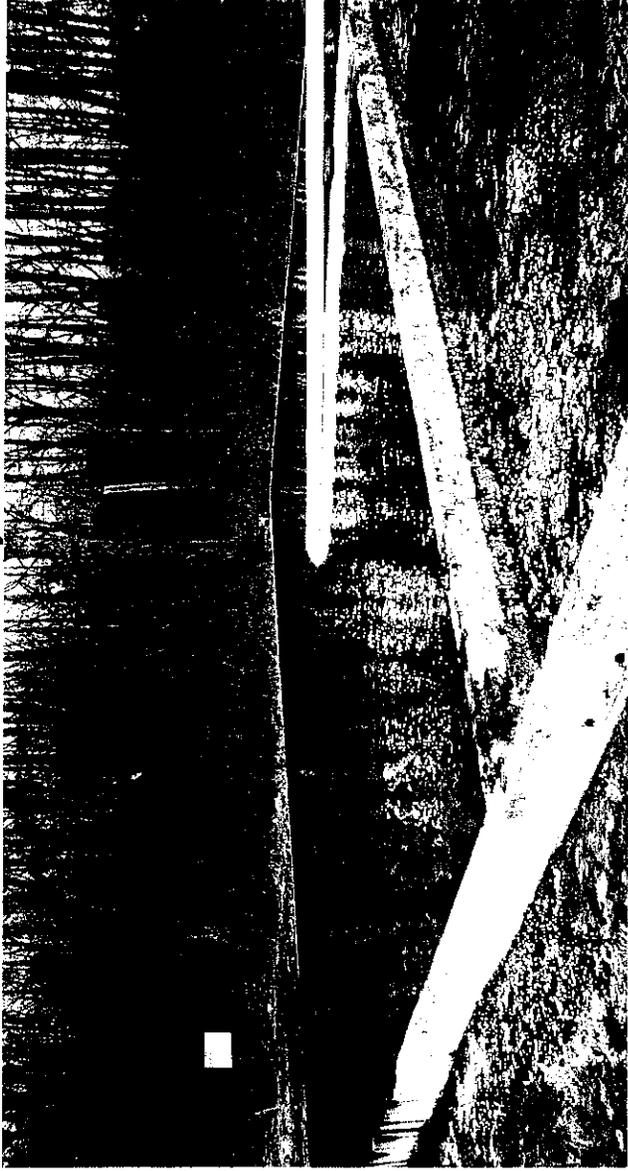

Filters plugged with solids and need cleaned.



Grey septic wastewater flowing overland to the receiving stream

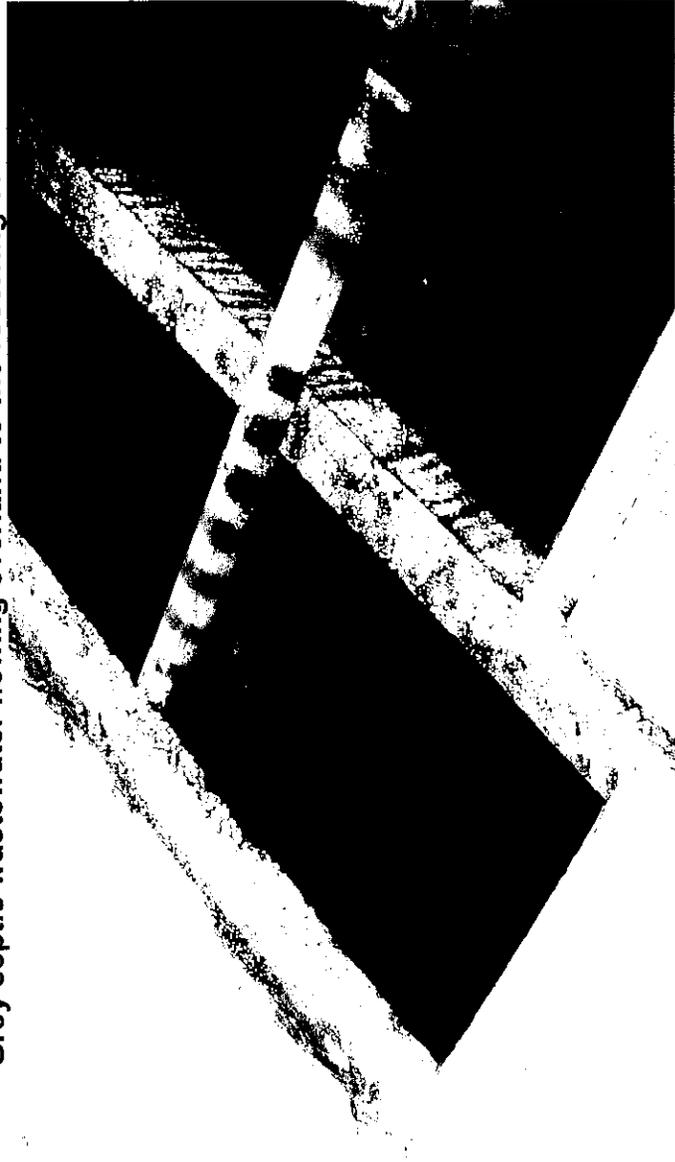

Grey septic effluent going over the weirs.