

**Environmental
Protection Agency**

Ted Strickland, Governor
Frank LaRocca, Lt. Governor
Chris Kuntz, Director

December 15, 2010

RE: ROBIN MHP's INC.
PERMIT NO. 3PV00058
PORTAGE COUNTY
MANTUA

Mr. Ronald Weiss, General Partner
Robin MHP's Inc.
3000 Town Center
Suite 540
Southfield, MI 48075

Dear Mr. Weiss:

On November 24, 2010, an inspection of the above referenced facility's wastewater treatment system was conducted. The facility was represented by Ms. Brenda Wieclaw, Park Office Manager. The purpose of the inspection was to evaluate the operation and maintenance of the treatment system along with the facility's compliance status with respect to the terms and conditions of the above referenced National Pollutant Discharge Elimination System (NPDES) permit.

During the inspection, the following items were noted/discussed:

1. Mr. Josh Goodridge from B&J Environmental remains the current operator of the wastewater treatment system. B&J Environmental is currently being contracted to operate the plant on a month to month basis.
2. B&J Environmental is responsible for collecting the samples and submitting the data in Ohio EPA's electronic discharge monitoring report (e-DMR) system.
3. Ms. Wieclaw indicated that the facility is currently taking bids for operating the wastewater treatment plant.
4. If a change in Operator of Record is made, an updated Operator of Record form must be submitted to the Director of Ohio EPA along with the Northeast District Office.
5. It should be noted that the wastewater treatment facility is classified as a Class 1 treatment works. This requires that the operator of record have a valid certification of a class equal to or greater than the classification of the treatment works "Class 1". Therefore, the operator of record is required to be present at the treatment plant 3 days per week for a minimum of 1.5 hours per week.
6. The blowers were running and the plant was receiving good aeration.
7. The flow equalization tank was also being aerated.
8. The contents of both the northern and southern aeration tanks were medium brown in color and no foam was present.
9. All sludge return lines in both aeration tanks were functioning properly and returning medium brown water.
10. The skimmer return line in the northern aeration tank was functioning properly and returning clear water.

Mr. Ronald Weiss
Robin MHP's Inc.
December 15, 2010
Page 2

11. The skimmer return line in the southern aeration tank was not functioning. It appeared that the skimmer height may have needed adjustment.
12. Scum/solids deposition was present behind the baffles in both settling tanks. The scum/solids deposition should be removed on a regular basis.
13. The weirs and the sidewalls in the settling tanks were free of solids.
14. All four surface sand filter beds were operable. The sludge layer was being raked off the beds. See Figures 1 & 2. Ms. Wieclaw indicated that the depth of the filter media was going to be evaluated and new filter media would be added as needed. Also, river rock was going to be placed around the splash pads in each filter bed. The river rock and filter media was already present at the site.
15. Ms. Wieclaw indicated that all sludge removed from the surface sand filter beds would be placed in dumpsters and sent to Waste Management.
16. The effluent was clear.
17. No visual impact to the receiving stream was observed.

This office has recently reviewed your self-monitoring reports covering the period January 1, 2010 through November 30, 2010 for the referenced facility. Our review indicates violations of the terms and conditions of your NPDES permit. The specific instances of noncompliance are as follows:

LIMIT VIOLATIONS

Station	Reporting Code	Parameter	Limit Type	Limit	Reported Value	Violation Date
001	80082	CBOD 5 day	7D Conc	15	20.	7/22/2010

No frequency violations were noted.

Please be advised that such instances of noncompliance may be cause for enforcement actions pursuant to the Ohio Revised Code, Chapter 6111.

Should you have any comments or questions concerning this letter, please feel free to call me at (330) 963-1143.

Respectfully,

Michael W. Stevens

Michael W. Stevens
Environmental Engineer
Division of Surface Water

MWS/mt

pc: Ms. Brenda Wieclaw, Park Office Manager

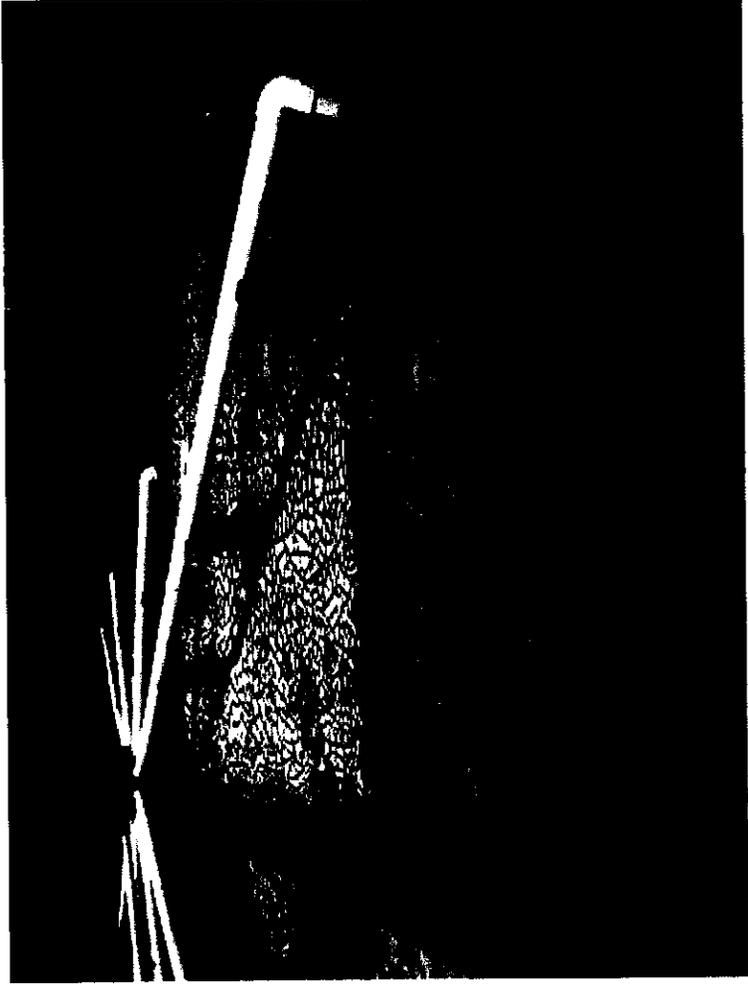


Figure 1



Figure 2