



**Environmental
Protection Agency**

John R. Kasich, Governor

Mary Taylor, Lt. Governor

Scott J. Nally, Director

May 2, 2012

Re: Perry County
RVM Realty, Inc.
(Moore's New Lexington Bulk Plant)
Compliance Evaluation Inspection
NPDES Permit 01N00228*CD
Correspondence (IWW)

Mr. Randy V. Moore
Randy V. Moore Petroleum Distribution, LLC
P. O. Box 208
New Lexington, Ohio 43764

Dear Mr. Moore:

On April 25, 2012, I conducted a Compliance Evaluation Inspection of the RVM Realty, Inc. bulk plant, located at 350 Tile Plant Road, in New Lexington, Ohio. You represented RVM Realty, Inc., and accompanied me during the inspection. The purpose of the inspection was to determine RVM Realty's compliance with NPDES Permit Number 01N00228*CD and the Ohio Water Pollution Control Act, Revised Code Chapter 6111. Photos were taken.

As a result of the inspection and review of our files, I have the following comments:

1. All solvents are stored under roof; oil is stored in a building.
2. Loading rack drain water is routed unimpeded to the underground Oil/Water separator tank. All other rain water which collects in diked areas around the tanks is held in the diked areas until normally locked drains are unlocked and it is routed to the separator tank.
3. Water pumped from the Oil/Water Separator goes to a small pond, where it is held prior to controlled discharge. The water in the pond did not show any sheen or indication of petroleum contamination. There was no discharge from the pond (outfall 001) at the time of the inspection. The outfall pipe was capped at the time of the inspection, and is normally closed.
4. A review of the facility Discharge Monitoring Reports (DMR's) for the period March 2011 thru March 2012, revealed one effluent violation, as follows:

Reporting Period	Station	Reporting Code	Parameter	Limit Type	Limit	Reported Value	Violation Date
June 2011	001	00550	Oil and Grease, Total	1D Conc	20	27.9	6/30/2011

Please be advised that failure to comply with the effluent limitations or to satisfy the monitoring or reporting requirements of your NPDES permit may be cause for enforcement action pursuant to the Ohio Revised Code Chapter 6111. If you have not already done so, please inform this office, in writing, within ten days of receipt of this notification as to the reasons for the above referenced violation, as well as a description of the actions taken or proposed to prevent any further violations. Your response should include the dates, either actual or proposed, for completion of the actions.

5. A small portion of the gravel parking area may be sloped in such a way that some clean rain water could get into the diked tank area (closest to the office). Please evaluate all facility drainage, and eliminate any potential for clean water to get into the collection/treatment system.

Attached is a copy of the inspection report which indicates satisfactory evaluations. On the day of the inspection, the facility was found to be in substantial compliance with the permit.

Sincerely,



Dan Messerly
District Staff Engineer
Division of Surface Water

DM/dh

Enclosure

NPDES Compliance Inspection Report

A. NATIONAL DATA SYSTEM CODING

Permit No.	NPDES No.	Date	Inspection Type	Inspector	Facility Type
01N00228*CD	OH0124591	April 25, 2012	C	S	2

B. FACILITY DATA

Name & Location of Facility Inspected	Entry Time	Permit Effective Date
RVM Realty, Inc. 350 Tile Plant Road New Lexington, Ohio 43764	1:10 p.m.	April 1, 2010
	Exit Time	Permit Expiration Date
	1:30 p.m.	March 31, 2015

Name(s) & Title(s) of On-Site Representative(s)	Phone Number(s)
Randy V. Moore, President	(740) 342-1875
Name, Address, & Title of Responsible Official	Phone Number
Randy V. Moore, President RVM Realty, Inc. Randy V. Moore Petroleum Distribution, LLC P.O. Box 208 New Lexington, Ohio 43764	(740) 342-1875


C. AREAS EVALUATED DURING INSPECTION

<u> </u> S Permit	<u> </u> S Flow Measurement	<u> </u> N/A Pretreatment
<u> </u> S Records/Reports	<u> </u> S Laboratory	<u> </u> N/A Compliance Schedules
<u> </u> S Operations & Maintenance	<u> </u> N Effluent/Receiving Waters	<u> </u> S Self-Monitoring Program
<u> </u> S Facility Site Review	<u> </u> N/A Sludge Storage/Disposal	<u> </u> Other
<u> </u> S Collection System		

(S = Satisfactory; M = Marginal; U = Unsatisfactory; N = Not Evaluated; N/A = Not Applicable)

D. SUMMARY OF FINDINGS/COMMENTS (attach additional sheets if necessary)

NPDES Permit lists 305 Tile Plant Road as location; should be 350 Tile Plant Road, as listed in application. No discharge at time of inspection. TCCI, New Lexington, does sampling, including field parameters. See cover letter.

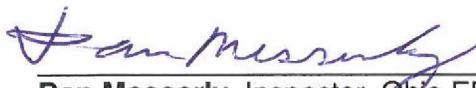

Dan Messerly, Inspector, Ohio EPA, Southeast District Office

5-1-12


Date



Jennifer M. Witte, Reviewer, Ohio EPA, Southeast District Office

5/1/12

Date

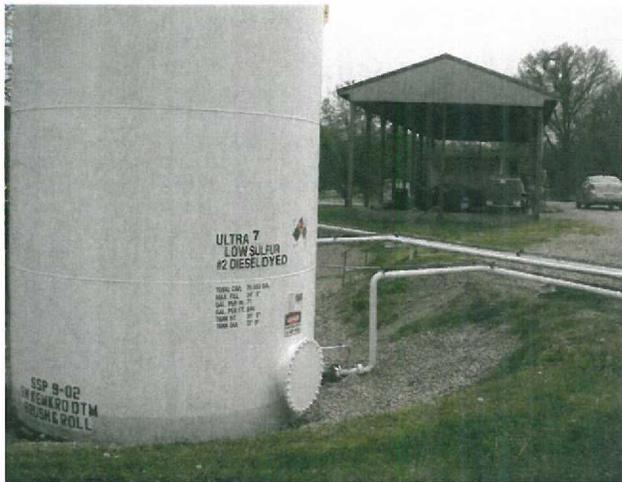

Perry County
RVM Realty Inc.
(Moore's New Lexington Bulk Plant)

April 25, 2012 CEI

OZN00228*CD

DJM.