



**Environmental  
Protection Agency**

John R. Kasich, Governor  
Mary Taylor, Lt. Governor  
Scott J. Nally, Director

August 27, 2012

Seth Bromberg  
TNT Powerwash, Inc.  
708 Internet Drive  
Columbus, OH 43207

**Re: Centerpoint - TNT Facility, Franklin County  
Construction General Permit #4GC03879\*AG**

Dear Mr. Bromberg:

This letter is written regarding the storm water inspection that I conducted on August 21, 2012, at your construction site located at 3220 Toy Road, in Obetz, Ohio. I understand that these construction activities are currently covered under the General Storm Water Permit Associated with Construction Activities. Based on my site inspection and the General Storm Water Permit, the following items must be addressed.


**Sediment and Erosion Controls:**

- There was active construction at the site during the inspection. Perimeter erosion controls such as silt fence needs to be installed and maintained at the site. A few sections of silt fence were installed at the site, but most of the silt fence was in need of repair. Please install filter covers on storm water drains. Please see attached pictures.
- Please be aware the General Permit mandates specific permanent and temporary stabilization requirements. All disturbed areas which remain idle in excess of 21 days must be protected from erosion within seven days of the last earth disturbing activities. All areas of final grade must be protected within seven days. All earth disturbing activities should be clearly logged in your inspection reports to ensure the 21 day / seven day requirement is not violated. The berm along the western property boundary appears to be at final grade.
- The General Permit requires the permittee to conduct inspections of all sediment and erosion controls every seven days or within 24 hours of a rain event equal to or greater than 0.5 inches. A log of the inspections at the site did not appear to be up-to-date. Please see attached pictures.
- Please submit an electronic copy of the storm water pollution prevent plan to [greg.sanders@epa.state.oh.us](mailto:greg.sanders@epa.state.oh.us). This site appears to be over five acres and would require a sediment pond located on-site. If the sediment pond located to the east of the site is to be used, please provide calculations to show this pond is adequate and has a property effluent structure to be used during construction.

- Your contractors, Thompson Excavating, and construction manager, Kirco Manix, will need to complete and submit a construction storm water co-permittee notice of intent application. This application may be obtained at the following weblink: <http://www.epa.state.oh.us/dsw/storm/stormform.aspx>. Your contractor/construction manager are considered an operator per the construction permit. "Operator" means any party associated with a construction project that meets either of the following two criteria:
  1. The party has operational control over construction plans and specifications, including the ability to make modifications to those plans and specifications; or
  2. The party has day-to-day operational control of those activities at a project which are necessary to ensure compliance with an SWP3 for the site or other permit conditions (e.g., they are authorized to direct workers at a site to carry out activities required by the SWP3 or comply with other permit conditions). As set forth in Part II.A, there can be more than one operator at a site and under these circumstances, the operators shall be co-permittees.

If you have any questions regarding this letter or my inspection, please do not hesitate to call me at our Central District Office at (614) 728-3851.

Sincerely,

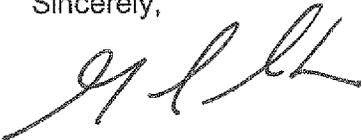

Gregory L. Sanders  
Environmental Specialist  
Division of Surface Water  
Central District Office

cc: Michael Moore, PE Kirco Manix  
Thompson Excavating

ec: Greg Sanders DSW/CDO

GS/nsm Centerpoint-TNT Facility, August 21, 2012

General & minimum inspection controls  
General & minimum inspection controls  
General & minimum inspection controls  
General & minimum inspection controls

2013

2013

UNIT 7  
UNIT 8  
UNIT 9  
UNIT 10  
UNIT 11  
UNIT 12  
UNIT 13  
UNIT 14  
UNIT 15  
UNIT 16  
UNIT 17  
UNIT 18  
UNIT 19  
UNIT 20  
UNIT 21  
UNIT 22  
UNIT 23  
UNIT 24  
UNIT 25  
UNIT 26  
UNIT 27  
UNIT 28  
UNIT 29  
UNIT 30  
UNIT 31  
UNIT 32  
UNIT 33  
UNIT 34  
UNIT 35  
UNIT 36  
UNIT 37  
UNIT 38  
UNIT 39  
UNIT 40  
UNIT 41  
UNIT 42  
UNIT 43  
UNIT 44  
UNIT 45  
UNIT 46  
UNIT 47  
UNIT 48  
UNIT 49  
UNIT 50  
UNIT 51  
UNIT 52  
UNIT 53  
UNIT 54  
UNIT 55  
UNIT 56  
UNIT 57  
UNIT 58  
UNIT 59  
UNIT 60  
UNIT 61  
UNIT 62  
UNIT 63  
UNIT 64  
UNIT 65  
UNIT 66  
UNIT 67  
UNIT 68  
UNIT 69  
UNIT 70  
UNIT 71  
UNIT 72  
UNIT 73  
UNIT 74  
UNIT 75  
UNIT 76  
UNIT 77  
UNIT 78  
UNIT 79  
UNIT 80  
UNIT 81  
UNIT 82  
UNIT 83  
UNIT 84  
UNIT 85  
UNIT 86  
UNIT 87  
UNIT 88  
UNIT 89  
UNIT 90  
UNIT 91  
UNIT 92  
UNIT 93  
UNIT 94  
UNIT 95  
UNIT 96  
UNIT 97  
UNIT 98  
UNIT 99  
UNIT 100

