



John R. Kasich, Governor
Mary Taylor, Lt. Governor
Scott J. Nally, Director

November 26, 2012

Mr. Les Bowman
Investco, Inc.
5888 State Route 36
Piqua, Ohio 45356

RE: Paris Court Reconnaissance Inspection / Notice of Violation

Dear Mr. Bowman:

On November 23, 2012 Joe Reynolds, of Ohio EPA Southwest District Office conducted a Reconnaissance Inspection at the Paris Court MHP Wastewater Treatment Plant, 10220 County Road 25 A, Piqua.

The inspection was conducted as part of a compliance review for the park with respect to the National Pollutant Discharge Elimination System (NPDES) permit (1PV00109*CD) requirements. The findings from the inspection are included in the attached report.

In order to address on-going permit compliance issues (wet weather treatment plant bypasses associated with clear water infiltration and inflow into the system), an engineering review of both the treatment plant and collection system will need to be performed. A formalized schedule for performing this work will need to be developed. The district office will be recommending the issuance of Director's Final Findings and Orders as part of the formalized schedule process.

If you have any questions regarding the report, please contact Mr. Joe Reynolds at (937) 285-6097.

Sincerely,

A handwritten signature in black ink that reads "Martyn Burt". The signature is written in a cursive style.

Martyn Burt
Compliance Supervisor
Division of Surface Water

MB/tb

Enclosure

ec: Miami County Public Health



State of Ohio Environmental Protection Agency
Southwest District Office

NPDES Compliance Inspection Report

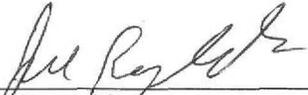
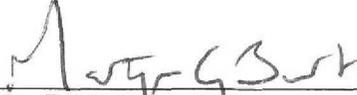
Section A: National Data System Coding					
Permit #	NPDES#	Month/Day/Year	Inspection Type	Inspector	Facility Type
1PV00109*CD	OH0127566	11/23/2012	R	S	1

Section B: Facility Data		
Name and Location of Facility Inspected	Entry Time	Permit Effective Date
Paris Court MHP 10220 County Road 25A Piqua, Ohio 45356	9:52 AM	9/1/2012
	Exit Time	Permit Expiration Date
	10:24 AM	8/31/2017
Name(s) and Title(s) of On-Site Representatives		Phone Number(s)
Bob Gomez (ORC, Winelco, not present @ insp.)		(513)775 - 8050
Name, Address and Title of Responsible Official		Phone Number
Les Bowman (Owner) Investco, Inc. 5888 State Route 36 Piqua, Ohio 45356		(937) 603 - 3456

Section C: Areas Evaluated During Inspection					
(S = Satisfactory, M = Marginal, U = Unsatisfactory, N = Not Evaluated)					
S	Permit	N	Flow Measurement	N	Pretreatment
N	Records/Reports	N	Laboratory	N	Compliance Schedule
N	Operations & Maintenance	N	Effluent/Receiving Waters	N	Self-Monitoring Program
S	Facility Site Review	N	Sludge Storage/Disposal	N	Other
U	Collection System				

Section D: Summary of Findings (Attach additional sheets if necessary)

- The Paris Court WWTP is designed to treat 17,100 gpd. The system includes a trash trap, flow equalization (7,200 gallons), two aeration tanks (19,000 gallons), two final clarifiers, four slow surface sand filters, chlorination, and dechlorination. Sludge is wasted to a 3,400 gallon sludge holding tank.
- During the period from January, 2011 through September, 2012 flows average 10,000 gpd with a peak of 80,000 gpd. During the months of April and December, 2011 flows averaged 20,000 gpd.
- Infiltration and Inflow are contributing to plant solids wash out onto the sand filters and plant overflows. In 2012 Paris Court reported two plant bypass events. One lasting a week, the second lasting two weeks. An infiltration and inflow study needs to be performed at the park.
- At the time of the inspection all four tertiary filters were drained. The two on-line had a small amount of algae and solids on their surface. The two off-line had a small amount of dried solids on their surface.

Inspector		Reviewer	
	11/26/2012		11/26/12
Joe Reynolds	Date	Martyn Burt	Date
Division of Surface Water		Compliance & Enforcement Supervisor	
Southwest District Office		Division of Surface Water	
		Southwest District Office	