



January 29, 2013

RE: Coshocton County
Hill Finishing
0616010089
Notice of Violation Non HPV/
Resolution of Violation

Certified: 70102780000197061883

Mr. Ervin Yoder
Hill Finishing
32795 Township Road 219
Millersburg, Ohio 44654

Dear Mr. Yoder:

On January 16, 2013, Sarah Harter and I performed an inspection at Hill Finishing located at 32795 Township Road 219, Coshocton County, Ohio. Rob Jarrett, of Jarrett Environmental Management Services, Ltd., was present throughout the inspection. This inspection was conducted to determine the facility's compliance with all applicable state and federal rules and regulations.

The permitted emissions units currently located at Hill Finishing includes R001, sealer booth, R002, topcoat booth, R003, stain booth, and P003, natural gas engine #1. Also located at this facility is one specialty coating booth, exempt per OAC rule 3745-31-03(A)(1)(kk), and a 400,000 Btu/hr wood fired boiler, exempt per OAC rule 3745-31-03(A)(1)(b). Permit-to-install (PTI) 06-08152 was issued January 18, 2007, for P001, a diesel fired generator, R001 and R002. PTI 06-08296 was issued July 24, 2007, for R003. Permit-to-install and operate (PTIO) P0089192 was issued May 7, 2009, for P001, R001, R002, and R003. P001 has since been replaced by P003. PTIO P0112200 was issued January 14, 2013, for P003. The permits for the facility will expire May 7, 2014.

The inspection began with a walk through of the facility. All four coating booths were observed in addition to the natural gas fired generator and the wood fired boiler. We then went inside the office and reviewed records with you and Mr. Jarrett. All records, as required by the permits, were provided with the exception of periodic and annual inspections of the filter systems. You stated the filters are changed approximately every week to two weeks. At the end of the year, all booths are shut down, cleaned, and fully inspected to ensure proper operation. Mr. Jarrett stated no records of these inspections were kept.

Violation:

PTIO P0089192 requires under d)(12) for R001, R002 and R003 the following:

"12. The permittee shall document each inspection (periodic and annual) of the dry particulate filter system and shall maintain the following information:

- a. the date of the inspection;*
- b. a description of each/any problem identified and the date it was corrected;*
- c. a description of any maintenance and repairs performed; and*
- d. the name of person who performed the inspection.*

These records shall be maintained at the facility for not less than five years from the date the inspection and any necessary maintenance or repairs were completed and shall be made available to the appropriate Ohio EPA District Office or local air agency upon request."

Resolution of Violation:

During the inspection, Mr. Jarrett provided an example inspection form that Hill Finishing will begin using to record all future inspections of the dry filtration systems. Ohio EPA requests Hill Finishing continue to comply with all monitoring and recordkeeping requirements.

Observation:


During the facility walk through I noticed the filters for R003 appeared to be very saturated with stain. I also noticed some overspray at the stack outlet of R003.

Request:

Ohio EPA requests Hill Finishing be diligent in the inspection and replacement of the filters.

Based on my inspection, file review, and reports submitted Hill Finishing, it appears that your facility has returned to compliance with all applicable Ohio EPA air rules. Should you have any questions or concerns, please feel free to contact me by telephone at (740)380-5246 or via email at racheal.davies@epa.ohio.gov.

Sincerely,

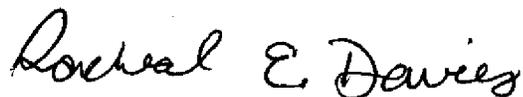

Racheal Davies
Division of Air Pollution Control
Southeast District Office

RD/cs

cc: Rob Jarrett/Jarrett Environmental Management Services, Ltd.