



**Environmental
Protection Agency**

John R. Kasich, Governor
Mary Taylor, Lt. Governor
Scott J. Nally, Director

November 21, 2011

Darke County Commissioners
County Administration Building
520 South Broadway
Greenville, OH 45331

**RE: NOTICE OF VIOLATION – Darke County Commissioners WWTPs
Compliance Evaluation Inspections (CEIs)
Rolin Acres WWTP, 1PG00090*CD/OH0085561
Stillwater Golf Estates WWTP, 1PX00014*CD/OH0119067
Darke County Home WWTP, 1PG00105*BD/OH0133612
Darke County Jail WWTP, 1PG00104*BD/OH0133621**

Ladies and Gentlemen:

On November 1, 2011, I conducted Compliance Evaluation Inspections at the four package wastewater treatment plants operated by the Darke County Commissioners. These inspections were conducted to evaluate performance of the wastewater treatment facilities and compliance with respective NPDES permits. Bill Marker, Operator of Record, accompanied me on these inspections.

Detailed inspection reports are attached for each of the facilities along with a listing of effluent limitation violations reported for each of the facilities.

Provide a response to the **"ITEMS REQUIRING A RESPONSE"** section in the inspection report by **December 21, 2011**. If you have any questions, I can be reached at (937) 285-6109.

Sincerely,

Joe Miller
Division of Surface Water

ec: William Marker, Operator of Record
Darke County Health Department

**Darke County Commissioners
Wastewater Treatment Plant Inspections
November 1, 2011**

ITEMS REQUIRING A RESPONSE

1. **Disinfection Violations** – Effluent limitation violations related to disinfection were reported for all four wastewater treatment facilities. The current means of wastewater disinfection in all four facilities is tablet chlorination and tablet dechlorination. Tablets clogging and difficulty balancing the chemicals were reasons cited for these violations. Installation of in-pipe ultraviolet disinfection is strongly recommended for these facilities to avoid continued effluent limitation violations.

2. **Inflow and Infiltration** – The following is an excerpt from the May 2011 Rolin Acres Inspection. A response was not received to this item. Provide the requested plan for the Rolin Acres facility.
 - i. **Excessive Infiltration and Inflow** – *Reported flows were as high as five times the design flow of the wastewater treatment plant. High flows contribute to effluent limitation violations. While this has been a longstanding issue with this facility, substantive improvements have not been completed to remedy the situation. Provide a detailed plan with a proposed date for submittal of a Permit to Install for equalization of influent.*

3. **pH Meter** – Currently pH testing is being sent to the contract laboratory for testing on each of the wastewater facilities. Purchasing a pH meter, allowing the operator to take required samples for all facilities along with the ability to troubleshoot treatment components, is recommended.

4. **Sand Filter Media** – The sand filter media needs to be replaced in the sand filters in the County Jail, County Home, Stillwater Golf Estates, and the East sand filter at Rolin Acres. Provide a schedule for replacement.

5. **Sand Filter Walls** – The sand filter walls at the County Home and County Jail are in poor condition, with exposed rebar and cracks allowing leakage. Repair and patch the sand filter walls.

6. **Effluent Violations** – Detail the reasons for the listed violations. Your response should include dates, either actual or proposed, for completion of actions to prevent future violations. ***Non-compliance notification is required for all violations as detailed in the NPDES permit, Part III, Item 12. Any future incidences must be reported in this manner.***

7. **Skimmer at Stillwater Golf Estates** – The skimmer on the south side of the treatment plant is too high and needs to be adjusted.

8. **Clarifier Maintenance** – Overall maintenance of wastewater plant clarifiers needs to be improved. Algae and sludge deposits were observed in the effluent weirs. Sludge wasting frequency may need to be increased along with clarifier weir cleaning.

OVERVIEW

The Darke County Commissioners own and operate four small extended aeration treatment plants. These facilities are located at the Rolin Acres Subdivision, Stillwater Golf Estates, the Darke County Home, and the Darke County Jail. The average design flow and average daily flow rates are as follows:

WWTP Facility	Average Design Flow	Average Daily Flow
Rolin Acres Subdivision	24,000 GPD	17,600 GPD
Stillwater Golf Estates	7,500 GPD	7,170 GPD
Darke County Home	10,000 GPD	7,993 GPD
Darke County Jail	10,000 GPD	2,183 GPD

Bill Marker is the Wastewater Operator or Record for these facilities. In addition, he will be the Operator of Record for the recently completed Osgood-North Star-Yorkshire regional treatment facility. He also monitors the Rossburg lift station at Ansonia for the county.

Infiltration and Inflow has been a problem in both the Stillwater Golf Estates and Rolin Acres Subdivision wastewater treatment collection systems. During periods of heavy storm flows, flows to the wastewater treatment exceed plant design resulting in the washout of solids to the sand filters and effluent limitation violations.

The Darke County Home and Darke County Jail are both located less than a mile from the City of Greenville's sanitary sewer collection system. The sewer is located along State Route 49 to the north. A number of businesses and residences are located along State Route 49 between the County properties and the sanitary sewer that have old or failing on-site septic systems. A sewer project to connect the County properties and the properties along State Route 49 would correct the conditions and eliminate the need for NPDES permits and monitoring.

Permit # : 1PG00104*BD
 NPDES # : OH0133621

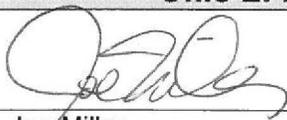
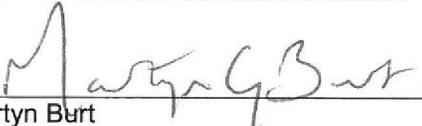


State of Ohio Environmental Protection Agency
 Southwest District Office

NPDES Compliance Inspection Report
 Semi-Public Sewage Disposal Inspection Form

Section A: National Data System Coding					
Permit #	NPDES#	Month/Day/Year	Inspection Type	Inspector	Facility Type
1PG00104*BD	OH0133621	11/1/11	C	S	1

Section B: Facility Data		
Name and Location of Facility Inspected	Entry Time	Permit Effective Date
Darke County Jail 5185 County Home Road Greenville, OH 45331	1:20 PM	5/1/2008
	Exit Time	Permit Expiration Date
	1:40 PM	4/30/2013
Name(s) and Title(s) of On-Site Representatives	Phone Number(s)	
Bill Marker	937-459-2317	
Name(s), Address and Title(s) of Operator of Record	Phone Number(s)	
Bill Marker	937-459-2317	
Name, Address and Title of Responsible Official	Phone Number	
Darke County Commissioners County Administration Building 520 South Broadway Greenville, OH 45331	937-547-7370	

Ohio EPA Inspector	Ohio EPA Reviewer
 Joe Miller Division of Surface Water Southwest District Office	 Martyn Burt Compliance & Enforcement Supervisor Division of Surface Water Southwest District Office
11/22/11 Date	11/22/11 Date

Permit # : 1PG00104*BD
 NPDES #: OH0133621

Average Daily Design Flow:	10,000 Gallons/Day
Plant Serves:	County Jail (Criminal Justice Center)
Average Daily Flow: (Period of Review):	2183 Gallons/Day (August 2010 to September 2011)
Method of flow monitoring:	Elapsed Time on dosing pumps
Type of alarms for plant:	unknown

Pretreatment

Type of Pretreatment: **Comminutor**
 Does the Trash Trap need pumped: **No**
 Maintenance of pretreatment components is: **Good**

Comments/Status:

Comminutor and trash trap, trash trap recently pumped

**Secondary Treatment
(Aeration)**

Color of sludge: **Dark Brown**
 Quality of Sludge: **Heavy**
 Foam: **Heavy (dark)**
 Odor: **No objectionable odor present**

	Yes	No		Yes	No
Aeration is taking place	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Plant is septic	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Blowers are operating	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Blowers are on a timer	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Skimmers are operating	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Plant is flooded	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Diffusers are operating	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Grating is present	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Sludge return is operating	<input checked="" type="checkbox"/>	<input type="checkbox"/>			

Maintenance of aerating equipment is...**Good**

Comments/Status:

**Secondary Treatment
(Settling)**

Clarity: **Solids Present**
 Condition of Weir: **Excessive Algae/Solids Build Up**
 Weir is level: **Yes**

Permit # : 1PG00104*BD
NPDES #: OH0133621

Effluent in weir: **Heavy Solids**
Clarifier walls need scraped: **Yes**

Overall maintenance of settling components is: **Poor**

Comments/Status:

Algae and sludge in effluent weir, walls need to be scraped and weir cleaned

Tertiary Treatment

	Yes	No		Yes	No
Surface sand Filters: Slow	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Subsurface	<input type="checkbox"/>	<input checked="" type="checkbox"/>
Distribution box operating	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Beds alternated	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Are filters ponding/flooding	<input type="checkbox"/>	<input checked="" type="checkbox"/>	Beds raked	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Sand filters overgrown	<input type="checkbox"/>	<input checked="" type="checkbox"/>	Chlorination present	<input type="checkbox"/>	<input checked="" type="checkbox"/>
UV present	<input type="checkbox"/>	<input checked="" type="checkbox"/>	Dechlorination present	<input type="checkbox"/>	<input checked="" type="checkbox"/>

Overall maintenance of components is: **Good**

Comments/Status:

Sand needs to be replaced in both filters. Sand filter walls in poor condition, areas with concrete worn down to rebar and cracked. Repair and patch the sand filter walls. Some dried sludge observed in area near sand filters. Dispose of sludge properly. Visual alarm. Not disinfection season.

Sludge Handling/Storage Disposal

Hauler name: **Mike's Sanitation Inc. (MSI)**
Disposal Site: **MSI Facility**
Sludge wasted from: **Sludge Holding tank**
How often is sludge wasted: **Unknown**
Sludge drying beds: **No** Sludge holding tank: **Yes**

Overall maintenance of components is: **Good**

Comments/Status:

Plant Discharge

Discharge point is a: **Ditch**
Name of discharge point: **unnamed tributary of Bridge Creek**
Discharge is visible: **Yes** Quality of Effluent: **Clear**

Comments/Status:

Permit # : 1PG00104*BD
NPDES # : OH0133621

EFFLUENT LIMIT VIOLATIONS
(Period of Review: 8/1/10-9/30/11)

7D = Weekly; 30D = Monthly; 1D = Daily; Conc. = Concentration (mg/l); Qty.= Quantity (Kg/Day)

Reporting Period	Parameter	Limit Type	Limit	Reported Value	Violation Date
September 2010	CBOD 5 day	30D Conc	10	12.3	9/1/2010
October 2010	CBOD 5 day	30D Conc	10	14.9	10/1/2010
November 2010	CBOD 5 day	30D Conc	10	12.635	11/1/2010
November 2010	CBOD 5 day	7D Conc	15	20.	11/1/2010
December 2010	Dissolved Oxygen	1D Conc	6.0	2.8	12/16/2010
December 2010	Dissolved Oxygen	1D Conc	6.0	2.5	12/28/2010
May 2011	Chlorine, Total Residual	1D Conc	0.019	.0594	5/12/2011
May 2011	Chlorine, Total Residual	1D Conc	0.019	.08	5/24/2011
June 2011	CBOD 5 day	30D Conc	10	12.8	6/1/2011
June 2011	Chlorine, Total Residual	1D Conc	0.019	.05	6/7/2011
June 2011	Chlorine, Total Residual	1D Conc	0.019	.05	6/28/2011